

# Part 573 Safety Recall Report

# 20V-565

**Manufacturer Name :** Braxton Creek RV**Submission Date :** MAY 15, 2021**NHTSA Recall No. :** 20V-565**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Braxton Creek RV

Address : 0925 North State Rd. 5

Shipshewana IN 46565

Company phone : 768-7932

**Population :**

Number of potentially involved : 620

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2020-2021 Bushwhacker 10FB and 10SS

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : There are two models affected in this recall.

Bushwhacker /10FB /2020 and 2021

Bushwhacker / 10SS / 2021

Production Dates : MAY 01, 2019 - JUL 31, 2020

VIN Range 1 : Begin : 7HFB1KB19L17X0050 End : 7HFB1KB18M17X1266

 Not sequential

VIN Range 2 : Begin : 7HFB1KB17M17B1047 End : 7HFB1KB11M17B1146

 Not sequential**Description of Defect :**

Description of the Defect : The lag bolts that we were using are too small and pulled through the floor sometimes causing the floor to come loose from the frame.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : The body of the trailer could shift or separate from the frame and cause injury or death to other motorists.

Description of the Cause : hwhat causes the trailer body to come loose from the frame is if you hit sharp bumps on the road or if you are off road in rough terrain.

Identification of Any Warning that can Occur : Usually the first sign of the body shifting is when you see the tires rubbing on the side of the trailer. If that's the case please take your Bushwhacker to your dealer ASAP.

**Involved Components :**

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

## Supplier Identification :

### Component Manufacturer

Name : NR

Address : NR

Indiana

Country : United States

## Chronology :

A floor came loose and shifted on the frame. We immediately started the recall process on 9/21/20. We completed all the dealer and customer notification letters by 10/30/2020.

## Description of Remedy :

Description of Remedy Program : The Bushwhacker owners will need to bring their trailer in to the servicing dealer where they bought the unit. We have a plan in place to bolt the floor onto the frame with 3/8" x 2" bolts and washers with a lock nut. We will reimburse the servicing dealer for the labor and any parts they use to fix this recall.

How Remedy Component Differs from Recalled Component : Once the correction is made the floor will be attached to the frame with bolts not just the self tapping screws.

Identify How/When Recall Condition was Corrected in Production : This correction was made as soon as it was discovered that the body was breaking loose and shifting on the frame.

## Recall Schedule :

Description of Recall Schedule : We will notify the dealer via email asap. After all the dealers are notified we will start mailing recall letters to all owners.

Planned Dealer Notification Date : SEP 21, 2020 - OCT 30, 2020

Planned Owner Notification Date : SEP 23, 2020 - OCT 30, 2020

\* NR - Not Reported