



Mercedes-Benz

Campaign No. 2020100006, October 2020

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model C-Class vehicles (205 platform)**
Model Year 2019
Check Center Console Storage Compartment

Mercedes-Benz AG (“MBAG”), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Model Year (“MY”) 2019 C-Class vehicles (205 platform), the center console storage compartment might not lock properly. Insufficient locking of the center console might lead to the center console storage compartment lid/door opening in the event of a rear-end collision, which would not comply with FMVSS 201 (Occupant Protection in Interior impact). An authorized Mercedes-Benz dealer will check the center console storage compartment on the affected vehicles and replace it, if necessary.

Prior to performing this Recall Campaign:

- **VMI must always be checked before performing campaigns to verify that the campaign is required on a specific vehicle. Always check for any other open campaigns, and perform accordingly.**
- Please review the entire Recall Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

Approximately 7 vehicles are involved.

Order No. P-RC-2020100006

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Check/test procedure

1. Remove the front center console stowage compartment.
 - i** For basic data, see **AR68.20-P-0901LWM**.
2. Check Q-status of the front center console stowage compartment.
 - i** The Q-status must be **at least Q-status 4**.
 - i** The Q-status can be read from the replacement part adhesive label after the replacement part number. It will be indicated as **Q4 (A, figure 1)**.
 - i** The replacement part adhesive label is located on the underside of the front center console stowage compartment (**figure 1**).



Figure 1

- a. If the Q-status is **less than 4**: Carry out **work procedure**.
- b. If the Q-status **is 4** or higher: **End measure**.

i The **findings** from the check/test procedure must be recorded **in writing on the workorder**.

Work procedure

1. Replace the front center console stowage compartment.
 - i** For basic data, see **AR68.20-P-0901LWM**.

Primary Parts Information

Qty.	Part Name	Part Number
As required (1)	Stowage compartment	A 205 680 13 04

Warranty Information**With check**

Operation: Check the front center console stowage compartment (02-2786)

Damage Code	Operation Number	Labor Time (hrs.)
68 900 02 7	02-2786	0.5

With check and replace

Operation: Check the front center console stowage compartment (02-2786)

Replace the front center console stowage compartment (after check) (02-2787)

Includes: Remove/install antenna for Keyless-Go; remove/install control unit for mobile phone cradle

Damage Code	Operation Number	Labor Time (hrs.)
68 900 02 7	02-2786	0.5
	02-2787	0.1

i Note

Operation Number labor times are subject to change.