


| | | | |
|--|--------------|---|----------------------------------|
|  Tesla, Inc. Service Bulletin | | Update Model Y Vehicle Firmware For Trailer Light Reliability | |
| SB-20-00-002 October 6, 2020 | | | |
| Classification | | Section/Group | Mobile Service |
| Recall Bulletin | | 00 - Inspection & Service | Can Perform (where permitted) |
| Model Year | Model | Country/Region | Version |
| 2020 | Model Y | North America | All |
| <small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small> | | | |

Recall Bulletin: Recall Bulletins are mandatory service procedures that must be carried out by Tesla-certified Service Centers. Recall work performed by uncertified technicians could lead to unsafe conditions or voided warranty provisions.

Condition

When Model Y is towing a trailer, the brake lamps on the trailer are required to illuminate upon the actuation of the service brake. A software error in certain Model Y vehicles equipped with a global rear lamp variant and a tow package configuration may prevent the towed trailer brake lamps from illuminating upon actuation of the service brake.

Correction

Inspect the firmware version operating on the vehicle and update it as necessary according to the procedure steps.

| Correction Description | Correction | Time |
|---|------------|------|
| SB-20-00-002 Not Applicable | S012000002 | 0.00 |
| Inspect Vehicle Firmware Version, No Update Necessary | S022000002 | 0.05 |
| Inspect Vehicle Firmware Version, Update Firmware | S032000002 | 0.05 |

Procedure

1. On the vehicle touchscreen, touch **Controls** (vehicle icon) > **Software**, and scroll down to display the vehicle firmware version.
2. If the vehicle is operating with firmware version:
 - 2020.35.101.06, then no further action is necessary
 - 2020.36.12, then no further action is necessary
 - 2020.40.3 or a newer release than 2020.40.3, then no further action is necessary
 - Any other version, then update to the latest available firmware release.