



Mercedes-Benz

Campaign No. 2020100010, October 2020

Revision B 11/20/2020

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model GLB-Class vehicles (247 platform)**
Model Year 2020
Check Mounting Window Airbag

Mercedes-Benz AG ("MBAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Model Year ("MY") 2020 GLB-Class vehicles (247 platform), the window airbag in the area of the A-pillar might not be mounted according to the current production specifications. In the event of a crash where the window airbag activates, the window airbag catch strap could disconnect. While the restraining effect of the window airbag is not affected, the vehicle might not meet the ejection mitigation requirements of FMVSS 226. An authorized Mercedes-Benz dealer will check the mounting of the window airbags on the affected vehicles and rework it, if necessary

Prior to performing this Recall Campaign:

- VMI must always be checked before performing campaigns to verify that the campaign is required on a specific vehicle. Always check for any other open campaigns, and perform accordingly.
- Please review the entire Recall Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

Approximately 7 vehicles are involved.

Order No. P-RC-2020100010

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Work procedure

1. Remove A-pillar trim.

i For basic data, see **AR68.30-P-4050MFA**.

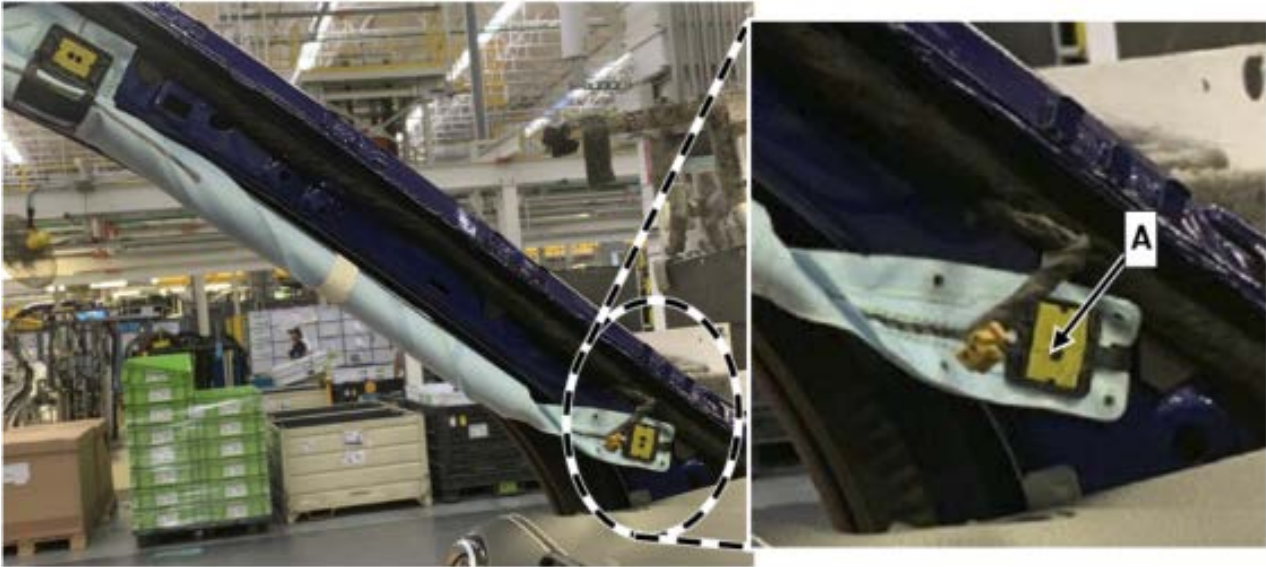


Figure 1

2. Press on clip. There should be no movement once pressed indicating that it is secured properly and locked in place (A, Figure 1).
3. Grasp fabric of Airbag and pull on it to ensure there is no movement of clip and it is secure.
4. Press on clip (A, Figure 1) again.

i The clip (A, Figure 1) must be attached correctly.
5. Assemble in reverse order.

Warranty Information

Operation: Check head airbag mount, rework if necessary (02-1633)

Damage Code	Operation Number	Labor Time (hrs.)
91 921 51 8	02-1633	0.3

i **Note**

Operation Number labor times are subject to change