

Part 573 Safety Recall Report**20V-662****Manufacturer Name :** Jayco, Inc.**Submission Date :** NOV 13, 2020**NHTSA Recall No. :** 20V-662**Manufacturer Recall No. :** 9903525**Manufacturer Information :**

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 165

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2021-2021 Jayco Motorized VisionEmblemVision XL Alante Precept Precept Prestige

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style :

Power Train : NR

Descriptive Information : Scope off affected motorhomes in process - waiting on information from LCI purchasing to compare with Jayco production schedule for specific unit serial numbers

2021 Vision M1AF8066-8080 AS8066-8101 AU8051-8075

2021 Emblem M1DH8051-8066 DT8051-8060 DU8051-8065

2021 Vision XL M1UA8051-8065 UG8064 8080

2021 Alante M1AF4061-4080 AS4066-4087 AU4074-4093

2021 Precept Prestige M1DH4051-4062

2021 Precept M1UA4051-4066 UG4069-4108 UL4051-4075 UV4051-4058

Production Dates : AUG 04, 2020 - SEP 22, 2020

VIN Range 1 : Begin : NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : Motors used in the LCI Power Bedlift system may fail due to internal gear failure - the shaft on the motor to spin freely.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Bed may extend from a stowed position increasing risk of injury. This could allow the bed to drop a short distance prior to the safety strap catching it.

Description of the Cause : Motor supplier manufacturing error -

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : LCI Power Bedlift

Component Description : Lift, Bed Power 54x91 Aluminum

Component Part Number : 0245705

Supplier Identification :

Component Manufacturer

Name : Lippert Componets, Inc.

Address : 1701 Centry Drive
Goshen INDIANA 46528

Country : United States

Chronology :

9-20-20 Incident report to Jayco regarding Driver in transit that the overhead bunk bed dropped hitting the driver on the head and the mattress dropped forward into the dash blocking driver's vision

9-21 Jayco contacted LCI regarding Incident

9-22 Jayco met with LCI - bed motor replace on unit reporting incident

9-28 Jayco received Quality alert from LCI stating the internal motor of the bed had potential of gear failure.

LCI came on sight at Jayco production lines - replaced motors on units still on site WIRC discussed and elevated to CPAC for further research 10-7 CPAC reviewed details of Incident and elevated to Safety

Committee recommending Recall

10-22 SSC reviewed details and agreed that Recall is required

Description of Remedy :

Description of Remedy Program : Replace original motor with new from different supplier - LCI to provide written instructions with new motor

How Remedy Component Differs from Recalled Component : The remedy motor has green and black wires and a brown gasket between the black cover on the housing for the gear box.
The recalled component has red and black wires on the side of a red gasket between the black cover and the housing for the gear box.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Jayco release is based on receipt of parts and repair instructions from LCI
Planned Dealer Notification Date : NOV 30, 2020 - NOV 30, 2020
Planned Owner Notification Date : NOV 30, 2020 - NOV 30, 2020

* NR - Not Reported