

Part 573 Safety Recall Report

20V-667

Manufacturer Name : Jayco, Inc.

Submission Date : NOV 25, 2020

NHTSA Recall No. : 20V-667

Manufacturer Recall No. : 9903527



Manufacturer Information :

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 360

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2020-2021 Class A Motorhome Alante, Vision, Vision XL, Precept, Precept Prestige

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style :

Power Train : NR

Descriptive Information : Production records noting first units scheduled with the added insulation material to units that received on line
Details of scope (US vs CN) unknown at this time

Production Dates : MAR 03, 2020 - AUG 04, 2020

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : Engine covers installed on some F-53 chassis did not contain appropriate insulation.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Under certain operation conditions, and wo the insulation material the interior surface temperatures could exceed desirable levels, exposing occupants to unreasonable risk of injury

Description of the Cause : Engineering change notice filed on 7-1-20 changed the engine cover configuration to add insulation material for the 2021 MY. A delay in tooling needed for the formed insulation materials caused some of the first 2021 units to have no insulation material.

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

8-24-20 Incident filed to report engine cover hot to the touch - Elevated to CPAC for research

9-2 CPAC continued research with Engineering and Operations

9-10 Request for testing by R&D submitted -

11-24 Edit - adding number of affected units with serial numbers

9-24- SSC reviewed situation and asked that additional testing / research be conducted prior to their decision how to proceed - testing continued through 10-2

10-22 SSC reviewed all details again and testing then agreed that a safety recall is required

Description of Remedy :

Description of Remedy Program : Jayco Dealer will remove and disable the engine cover to allow the addition of the insulation insert - reassemble engine cover and install foam seal on the outer edge.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : All units produced after 8-4-20 contain the insulation insert.

Recall Schedule :

Description of Recall Schedule : Jayco will release upon receipt of parts

Planned Dealer Notification Date : DEC 18, 2020 - DEC 18, 2020

Planned Owner Notification Date : DEC 18, 2020 - DEC 18, 2020

* NR - Not Reported