#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

## 21E-015

**Manufacturer Name:** Bendix Commercial Vehicle Systems, LLC

**Submission Date:** MAR 01, 2021 **NHTSA Recall No.:** 21E-015

**Manufacturer Recall No.:** NR



#### **Manufacturer Information:**

Manufacturer Name: Bendix Commercial Vehicle Systems,

LLC

Address: 901 Cleveland Street

Elyria OH 44035

Company phone: 440-329-9000

### **Population:**

Number of potentially involved: 2,090 Estimated percentage with defect: 100 %

#### **Equipment Information:**

Brand / Trade 1: Bendix

Model: SC-3 Part No.: K094964

Size: NR

Function: Check Valve

Descriptive Information: All SC-3 Check Valves manufactured between 7/27/2020 and 9/9/2020 are

subject to this recall. The recalled SC-3 single check valves may not have the retainer fully seated in the retainer groove. The SC-3 check valves that are not subject to this recall have the retainer fully seated in the retainer groove.

Production Dates: JUL 27, 2020 - SEP 29, 2020

#### **Description of Defect:**

Description of the Defect: A retainer was not properly seated during assembly of the SC-3 Single Check

valve, such that when air pressure is applied, it may no longer provide source

air isolation as defined and required by FMVSS 121.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: A spring brake application that is uncommanded by the driver may result.

The degree of the spring brake application being vehicle schematic and secondary reservoir failure dependent. The uncommanded spring brake

application may increase the risk of a crash.

Description of the Cause: A setup-up error at the supplier caused the retainer to not be pressed to the

correct depth in the part.

Identification of Any Warning Such an occurrence may become known to a vehicle operator upon a secondary

reservoir circuit failure. The secondary circuit failure may trigger a low

that can Occur: pressure warning in the vehicle.

#### **Involved Components:**

Component Name: SC-3

Component Description: Single Check Valve

Component Part Number: K094964

#### **Supplier Identification:**

#### **Component Manufacturer**

Name: Parker Brass Address: 300 Parker Dr

Otsego Michigan 49078

**Country: United States** 

#### **Chronology:**

See attached file

#### **Description of Remedy:**

Description of Remedy Program: TBD

How Remedy Component Differs Only SC-3 single check valves manufactured between 7/27/2020 and

from Recalled Component: 9/29/2020 may contain the defect.

Identify How/When Recall Condition The supplier has added software validation of the assembly setup process

was Corrected in Production: and in-process control of the press operation to validate that the check

valve retainer is fully seated and will not separate.

#### **Recall Schedule:**

Description of Recall Schedule: Because there are no sales of the SC-3 into the aftermarket, Bendix does

not plan to notify dealers or owners. The OEM's listed in this notice will

be notified by 4/19/2021.

Planned Dealer Notification Date: NR - NR

Planned Owner Notification Date: NR - NR

#### **Purchaser Information:**

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name: Blue Bird Corporation Address: 3920 Arkwright Rd

Suite 200 Macon GA 31210

Country: US Company Phone: NR

> Name: Navistar, Inc Address: 2701 Navistar Dr.

**Lisle IL 60532** 

Country: US Company Phone: NR

> Name: Oshkosh Corporation Address: 3031 Oregon St.

Oshkosh WI 54902

Country: US Company Phone: NR

> Name: New Flyer of America, Inc Address: 6200 Glenn Carlson Drive

> > **St.Cloud MN 56301**

Country: US Company Phone: NR

<sup>\*</sup> NR - Not Reported