

RECALL 21V172. 2021-143 REMEDY INSTRUCTIONS



Make(s): Clipper and Viking
Model(s): CWT182DBU & VWT182DBU
Model Year(s): 2021

Concern:
The manufacturing plant did not install nor seal the panel, which isolates the furnace from the cooktop.

Repair Code: RC-030-03-00-004004

Allotted Time: 1.00 HRS

Inspection Code: N/A

Allotted Time: N/A

Photo(s) Required: NO

Prior Authorization Required: NO

Part(s) Kit Number: N/A

Part(s) Return: N/A

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

STEP 1: REMOVE COOKTOP FROM THE KITCHEN COUNTER; (FIGURE 1)

- KEEP FASTENERS TO USE TO RE-INSTALL THE COOKTOP
- DO NOT DISCONNECT THE LPG LINE FROM THE COOKTOP

STEP 2: MEASURE THE FULL WIDTH AND DEPTH OF THE OPENING ABOVE THE DRAWER; (FIGURE 2)

- CUT A SINGLE PANEL THE SIZE THAT FITS THE OPENING (FIGURE 2)
- CUT THE PANEL IN HALF SO IT MAY BE INSTALLED EASIER (FIGURE 3)
- INSTALL CLETES TO PANELS "FRONT AND REAR" TO SCREW TO THE WALL (FIGURE 3)
- NOTCH ONE PANEL FOR THE LPG HOSE AND NOTCH FOR CABINET CLETES (FIGURE 3)

STEP 3: ONCE INSTALLED, USE SEAM TAPE OR DUCT TAPE TO COVER THE PANEL SEAM; (FIGURE 4)

- USING THE TAPE WILL SEAL THE SPLICE BETWEEN THE PANELS AND NOT ALLOW AIR FLOW

STEP 4: USE SILICONE SEALANT TO SEAL THE PANELS AROUND THE PARAMETER OF THE PANELS AND AGAINST THE SINK CABINET. ENSURE TO SEAL AROUND ANY CLETES AND WHERE THE LPG HOSE IS;

STEP 5: RE-INSTALL COOPTOP;

STEP 6: TEST;

- TURN ON LPG
- SET FURNACE TO HIGHEST SETTING
- IGNITE COOKTOP AND LET BURN
- THE FLAME SHOULD NOT INVERT WHEN THE FURNACE IS RUNNING.

SEE ATTACHED FOR PHOTO'S

RECALL 21V172. 2021-143 REMEDY INSTRUCTIONS



Make(s): Clipper and Viking
Model(s): CWT182DBU & VWT182DBU
Model Year(s): 2021

Concern:
The manufacturing plant did not install nor seal the panel, which isolates the furnace from the cooktop.

Repair Code: RC-030-03-00-004004

Allotted Time: 1.00 HRS

Inspection Code: N/A

Allotted Time: N/A

Photo(s) Required: NO

Prior Authorization Required: NO

Part(s) Kit Number: N/A

Part(s) Return: N/A

FIGURE 1



FIGURE 2

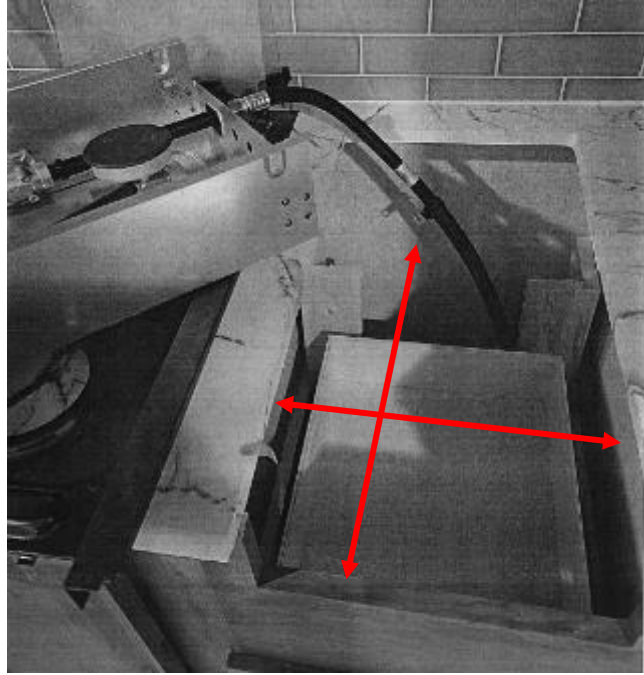


FIGURE 3

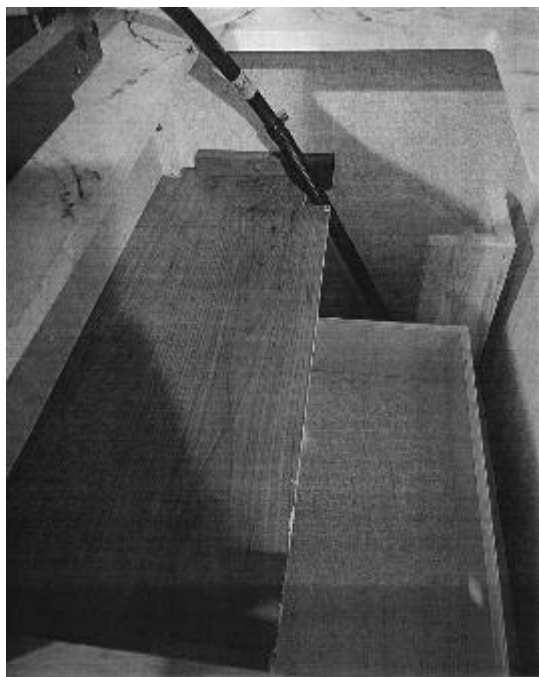


FIGURE 4

