

Part 573 Safety Recall Report

21V-190

Manufacturer Name : General Motors, LLC**Submission Date :** MAR 25, 2021**NHTSA Recall No. :** 21V-190**Manufacturer Recall No. :** N202313000**Manufacturer Information :**

Manufacturer Name : General Motors, LLC

Address : 29427 Louis Chevrolet Road
MAIL CODE 480-210-2V WARREN MI
48093

Company phone : 586-596-1733

Population :

Number of potentially involved : 94,641

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2021-2021 Cadillac Escalade

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Manufacturing records were used to identify the recall population. Vehicles without a third row and vehicles built on or after November 18, 2020 are not affected by this recall.

3759 Cadillac Escalade vehicles are affected by this recall.

Production Dates : MAR 16, 2020 - NOV 18, 2020

VIN Range 1 : Begin : NR End : NR

 Not sequential

Vehicle 2 : 2021-2021 Cadillac Escalade ESV

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Manufacturing records were used to identify the recall population. Vehicles without a third row and vehicles built on or after November 18, 2020 are not affected by this recall.

2085 Cadillac Escalade ESV vehicles are affected by this recall.

Production Dates : JUN 24, 2020 - NOV 18, 2020

VIN Range 1 : Begin : NR End : NR

 Not sequential

Vehicle 3 : 2021-2021 Chevrolet Suburban

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Manufacturing records were used to identify the recall population. Vehicles without a third row and vehicles built on or after November 18, 2020 are not affected by this recall.

14797 Chevrolet Suburban vehicles are affected by this recall.

Production Dates : JAN 06, 2020 - NOV 18, 2020

VIN Range 1 : Begin : NR End : NR Not sequential

Vehicle 4 : 2021-2021 Chevrolet Tahoe

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Manufacturing records were used to identify the recall population. Vehicles without a third row and vehicles built on or after November 18, 2020 are not affected by this recall.

42,588 Chevrolet Suburban vehicles are affected by this recall.

Production Dates : NOV 11, 2019 - NOV 18, 2020

VIN Range 1 : Begin : NR End : NR Not sequential

Vehicle 5 : 2021-2021 GMC Yukon

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Manufacturing records were used to identify the recall population. Vehicles without a third row and vehicles built on or after November 18, 2020 are not affected by this recall.

22,195 GMC Yukon vehicles are affected by this recall.

Production Dates : NOV 12, 2019 - NOV 18, 2020

VIN Range 1 : Begin : NR End : NR Not sequential

Vehicle 6 : 2021-2021 GMC Yukon XL

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Manufacturing records were used to identify the recall population. Vehicles without a third row and vehicles built on or after November 18, 2020 are not affected by this recall.

9217 GMC Yukon XL vehicles are affected by this recall.

Production Dates : JAN 06, 2020 - NOV 18, 2020

VIN Range 1 : Begin : NR End : NR Not sequential

Description of Defect :

Description of the Defect : General Motors has decided that a defect which relates to motor vehicle safety exists in certain 2021 model year Cadillac Escalade and Escalade ESV vehicles; Chevrolet Suburban and Tahoe vehicles; and GMC Yukon and Yukon XL vehicles with third-row seating. During installation of the third-row seat, one or both third-row outboard seat belts may have been inadvertently entrapped in or misrouted behind the outboard seat-folding mechanism. A seat belt in this condition may be damaged by the seat-folding mechanism.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A damaged seat belt can break during a crash, increasing the risk of injury to the occupant.

Description of the Cause : During installation of the third-row seat, one or both third-row outboard seat belts may have been inadvertently entrapped in or misrouted behind the outboard seat-folding mechanism. This condition can only occur during vehicle assembly.

Identification of Any Warning that can Occur : Vehicle owners may notice damage to or difficulty using a third-row seat belt, or difficulty latching or operating the third-row seat.

Involved Components :

Component Name 1 : RETRACTOR ASM-3RD ROW ST BELT

Component Description : 3rd Row Seat Belt Assembly

Component Part Number : 84929395, 84929401, 84935018, 84935024

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

Chronology :

"See Attached"

Description of Remedy :

Description of Remedy Program : Dealers will inspect third-row outboard seat belts for damage and correct routing. Seat belts that are damaged will be replaced. Routing will be corrected for any belts that are misrouted.
Pursuant to 49 C.F.R. § 573.13(d) (1), all covered vehicles are under warranty, so reimbursement is not offered.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : Containment efforts were initiated on November 18, 2020 requiring post-installation inspection of the third-row seat and seat belt at the plant.

Recall Schedule :

Description of Recall Schedule : Dealers will be notified on March 18, 2021. Owner notification is estimated to begin on May 3, 2021.

Planned Dealer Notification Date : MAR 18, 2021 - MAR 18, 2021

Planned Owner Notification Date : MAY 03, 2021 - MAY 03, 2021

* NR - Not Reported