#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

## 21V-328

**Manufacturer Name:** PACCAR Incorporated

NHTSA Recall No.: 21V-328

Manufacturer Recall No.: 21PBE



#### **Manufacturer Information:**

Manufacturer Name: PACCAR Incorporated

Address: 777 106TH AVENUE NORTHEAST

**BELLEVUE WA 98004** 

Company phone: 940 591 4220

## **Population:**

Number of potentially involved: 13 Estimated percentage with defect: 1 %

#### **Vehicle Information:**

Vehicle 1: 2021-2021 Peterbilt 348, 579

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : Power Train : NR

Descriptive Information: Recall population was determined based on Meritor's identification of line-sequenced

assemblies produced with TSE-supplied chambers before TSE's heat treat fixture was

corrected.

Production Dates: MAR 11, 2020 - JUL 13, 2020

### **Description of Defect:**

Description of the Defect: Brake chamber with mis-aligned park spring may cause fatigue hole in

diaphram and internal air leak.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Air leak could drain air system pressure, causing brake drag and setting park

brakes, increasing the risk of a crash

Description of the Cause: Root cause was determined to be the deformation of the spring after the heat-

treat process due to the heat-treat fixture allowing springs to touch each other. The perpendicularity of the spring can cause the pressure plate to be misaligned and cause a fatigue hole in the diaphragm. TSE fixed the heat-treat fixture as well as tightened the allowable tolerance and frequency of

inspections during heat-treat process

Identification of Any Warning A variety of warnings can occur, including low air warnings, difficulty going

that can Occur: into gear due to low air pressure, audible air leaks and inability to build up

enough pressure to release park brakes.

#### **Involved Components:**

Component Name 1: ADB Brake Assembly

Component Description: NR

Component Part Number: C75-6011-32024L201 and C75-6011-32024R201

#### **Supplier Identification:**

## **Component Manufacturer**

Name: Meritor

Address: 2135 W Maple Rd

Troy Michigan 48084

**Country: United States** 

## **Chronology:**

4/5/21 - Meritor informed Peterbilt Product Safety & Compliance that their brake chamber supplier had a potential quality issue with 52 brake chambers that were installed on Peterbilt trucks.

4/6/21 - Meritor and Paccar met to discuss details of the issue, containment and suspect population.

4/7/21 - Meritor provided summary of their testing of the suspect brake chambers and more information from Walmart's experience with the suspect brake chambers.

4/12/21 - 4/23/21 - Peterbilt Product Safety and Compliance communicated with Meritor regarding issue and suspect brake chamber list.

5/3/21 - Meritor sent a copy of their 573 defect report filed April 08, 2021.

5/4/21 - PB Safety Committee met and determined a defect relating to motor vehicle safety exists.

#### **Description of Remedy:**

Description of Remedy Program: Peterbilt dealers will replace suspect brake chambers on trucks in the field

free of charge.

How Remedy Component Differs The remedy component has a correctly aligned park spring, as can be from Recalled Component: observed by visual inspection of the chamber. On recalled components, when looking through the cage bolt hole, a mis-aligned spring and

pressure plate can be seen by the hole in the pressure plate not lining up with the cage bolt hole.

Identify How/When Recall Condition NR was Corrected in Production:

#### **Recall Schedule:**

Description of Recall Schedule: notifications will be mailed within 60 days

Planned Dealer Notification Date: JUL 09, 2021 - JUL 09, 2021 Planned Owner Notification Date: JUL 09, 2021 - JUL 09, 2021

\* NR - Not Reported