39

Part 573 Safety Recall Report

Manufacturer Name :Forest River, Inc.Submission Date :JUL 20, 2021NHTSA Recall No. :21V-350Manufacturer Recall No. :220-1336

Manufacturer Information :

Manufacturer Name :Forest River, Inc.Address :55470 CR 1P.O. Box 3030 Elkhart IN 46515-3030Company phone :1-800-348-7440

Vehicle Information :

Vehicle 1 : Vehicle Type : Body Style : Power Train :	OTHER
Descriptive Information :	Manufacturing determined the wiring error on May 6, 2021. Using production records the plant was able to look back at the start of the manufacturing schedule and determine the starting VIN and ending VIN. 2021 Spirit Travel Trailer SBT1943RB 17 2021 Spirit Travel Trailer SBT2557RB 4 2021 Spirit Travel Trailer SBT2963BH 15 2021 Spirit Travel Trailer SBT3379BH 3
Production Dates : VIN Range 1 :	APR 28, 2021 - MAY 06, 2021 Begin : NR End : NR Image: NR Image: Not sequential

Description of Defect :

Description of the Defect :	The Breakaway switch power lead is wired to the auxiliary side of the battery disconnect. Without constant power to the switch, it may not engage when needed and consequently not allow the trailer brakes to activate.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	If the battery disconnect is in the "off" position, the breakaway switch will not engage when needed, the trailer brakes will not activate which may lead to a crash resulting in property damage, injury and/or death.
Description of the Cause :	Breakaway switch wired incorrectly.

The information contained in this report was submitted pursuant to 49 CFR §573



Number of potentially involved :

Estimated percentage with defect : 100 %

Population :

21V-350

Part 573 Safety Recall Report

Identification of Any Warning None. that can Occur :
Involved Components :
Component Name 1: Battery Disconnect
Component Description : Battery Disconnect
Component Part Number: N/A
Component Name 2: Breakaway Switch
Component Description : Breakaway Switch
Component Part Number : N/A
Supplier Identification :
Component Manufacturer
Name : NR
Address : NR
NR Country : NR
Country. NR

Chronology :

On May 7, 2021, The manufacturing plant notified Forest River's Office of Corporate Compliance ("OCC") that the breakaway switch may not have been wired to the correct battery disconnect terminal.

On May 10, 2021, OCC opened an investigation with the manufacturing plant.

On May 12, 2021, OCC and the plant determined the wiring in question was isolated to a certain manufacturing schedule and ended on April 6, 2021. All vehicles in Forest River possession where inspected and remedied as needed.

On May 14, 2021, Forest River's Corporate Recall Committee voted to recall.

A-1 On July 20, 2021 filed an amendment to add the breakaway switch and battery disconnect to component

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

information as requested by NHTSA.		
Description of Remedy :		
Description of Remedy Program :	Forest River will provide all parts and labor at no charge to the consumer. An authorized Forest River or Coachmen dealer or service center will need to perform the remedy. The remedy will include wiring the breakaway switch to the constant power lug to the battery disconnect.	
	What is the Forest River Customer Service Phone Number? (574) 825-8205	
How Remedy Component Differs from Recalled Component :	The breakaway switch will now be wired to the correct constant power lug at the battery disconnect.	
	The week of May 6, 2021 the manufacturing plant began wiring the breakaway switch to the correct constant power lug at the battery disconnect.	
Recall Schedule :		
-	Forest River has the utmost urgency in our recalls. Forest River will send suspected VIN numbers to our third party vendor that is licensed to pull data on the current owner of the vehicles (as needed) once a formal NHTSA I.D. is provided. Forest River intends on pushing the mailing out as soon as NHTSA provides any correction(s) and an Acknowledgement Letter.	
Planned Dealer Notification Date :		
Planned Owner Notification Date :	JUN 23, 2021 - JUN 23, 2021	

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573