

Part 573 Safety Recall Report

21V-361

Manufacturer Name : Ducati North America

Submission Date : MAY 17, 2021

NHTSA Recall No. : 21V-361

Manufacturer Recall No. : SRV-RCL-21-009



Manufacturer Information :

Manufacturer Name : Ducati North America

Address : 1292 Reamwood Avenue
Sunnyvale CA 94089

Company phone : 719 209 4609

Population :

Number of potentially involved : 228

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2021-2021 Ducati Scrambler 800 Night Shift

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

Descriptive Information : Due to an error on this bike model bill of material, these motorcycles were assembled on the Ducati Motor production plant with the incorrect front and rear turn indicators. The front and rear turn signals do not guarantee the “effective projected luminous lens area requirements” required by the FMVSS (Federal Motor Vehicle Safety Standards) No. 108. 228 vehicles require the update.

Production Dates : FEB 05, 2021 - APR 03, 2021

VIN Range 1 : Begin : MLOKAFPM8MT004187 End : MLOKAFPM1MT004600 ☒ Not sequential

Description of Noncompliance :

Description of the Noncompliance : The front and rear turn signals do not guarantee the “effective projected luminous lens area requirements” required by the FMVSS (Federal Motor Vehicle Safety Standards) No. 108.

FMVSS 1 : 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS 2 : NR

Description of the Safety Risk : As a result, reduced projected luminous lens area requirements, cause the subject vehicles to not meet certain requirements in FMVSS (Federal Motor Vehicle Safety Standards) No. 108.
If traffic is unable to notice the front and rear turn signals lights, it may result in an increased risk of a crash.

Description of the Cause : Due to an error on this bike model bill of material, these motorcycles were assembled on the Ducati Motor production plant with the incorrect front and rear turn indicators.

Identification of Any Warning N/A
that can Occur :

Involved Components :

Component Name 1 : Turn indicator

Component Description : Front and rear turn indicator

Component Part Number : 53010521A

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

On April 29, 2021 an internal check has raised that all the first part of production of this specific bike model was assembled with the incorrect front and rear turn signals.

After that was defined that the turn signals were not meet certain requirements in FMVSS.

On May 11, 2021, Ducati Motor Holding's internal safety commission decided to launch a recall campaign to address this condition in the affected population.

Description of Remedy :

Description of Remedy Program : Ducati North America will notify dealers and owners of this recall in accordance with the notification schedule. Dealers will be instructed to install different front and rear turn signals, free of charge, per Ducati North America Recall Bulletins, which will be published to the Ducati Dealer Network using the established communication process. Requests for reimbursement for pre-notification repairs will be considered in accordance with Ducati's general reimbursement plan on file with the agency.

How Remedy Component Differs from Recalled Component : The remedy front and rear turn signals are in line with FMVSS's requirements.

Identify How/When Recall Condition was Corrected in Production : The same Recall remedy have been introduced on Ducati production plant.

Recall Schedule :

Description of Recall Schedule : Ducati North America Recall Bulletins will be published to the network of dealers through an established communication process. We estimate that we will initiate the Recall contact process for affected motorcycle owners during June 2021, but no later than 60 days from submission of this report.

Planned Dealer Notification Date : MAY 24, 2021 - MAY 31, 2021

Planned Owner Notification Date : JUN 23, 2021 - JUN 30, 2021

* NR - Not Reported