

# Part 573 Safety Recall Report

## 21V-363

**Manufacturer Name :** KTM North America, Inc.**Submission Date :** MAY 17, 2021**NHTSA Recall No. :** 21V-363**Manufacturer Recall No. :** HTB2105**Manufacturer Information :****Manufacturer Name :** KTM North America, Inc.**Address :** 1119 Milan Avenue  
Amherst OH 44001**Company phone :** 440-985-3553**Population :****Number of potentially involved :** 171**Estimated percentage with defect :** 1 %**Vehicle Information :****Vehicle 1 :** 2020-2020 Husqvarna Motorcycle 701 Enduro LR**Vehicle Type :** MOTORCYCLES**Body Style :** OTHER**Power Train :** GAS

**Descriptive Information :** - All 2020 Husqvarna 701 Enduro LR are included in the population.  
 -On the affected population, there is a possibility abrasion may occur on both fuel lines located on the front fuel tank.

**Production Dates :** MAR 05, 2020 - OCT 13, 2020**VIN Range 1 :Begin :** VBKUEV404LM795818 **End :** VBKTR3406LM790768 ☒ Not sequential**Description of Defect :****Description of the Defect :** On affected motorcycles, it is necessary to install two newly designed fuel lines with an additional clamp that position the fuel lines away from the contact points on the front fuel tank that could cause abrasion.**FMVSS 1 :** NR**FMVSS 2 :** NR**Description of the Safety Risk :** The presence of a leak could result in the possibility of damage or possible fire, which could cause injury to the rider or others and/or damage to property.**Description of the Cause :** The cause of the defect is from the shape and mounting position of the original fuel lines on the front fuel tank.**Identification of Any Warning that can Occur :** None**Involved Components :**

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

### Supplier Identification :

#### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

### Chronology :

December 2020 during an end-of-line inspection, KTM AG Quality Control found abrasion on the fuel lines of the affected population. In December 2020 KTM AG Quality Control began an investigation and found occasional abrasion on both fuel lines at the front fuel tank. KTM AG determined in December 2020, that a recall was needed. Following the determination R&D and Quality Control evaluated and tested the repair method and line process until April 2021.

### Description of Remedy :

Description of Remedy Program : Two newly-designed fuel lines with a new shape and an additional clamp will be installed.

How Remedy Component Differs from Recalled Component : Replacement parts are identified with a unique newly assigned part number.

Identify How/When Recall Condition was Corrected in Production : In the assembly process, the newly designed parts will be used and installed.

### Recall Schedule :

Description of Recall Schedule : Husqvarna Motorcycles North America is notifying all registered owners of the above-affected motorcycles by mail and all authorized dealers via Husqvarna Dealernet, an internet-based communication portal.

Planned Dealer Notification Date : MAY 14, 2021 - JUL 22, 2022

Planned Owner Notification Date : JUN 11, 2021 - JUL 29, 2022

\* NR - Not Reported