

# Part 573 Safety Recall Report

## 21V-363

**Manufacturer Name :** KTM North America, Inc.**Submission Date :** JUN 29, 2021**NHTSA Recall No. :** 21V-363**Manufacturer Recall No. :** HTB2105**Manufacturer Information :**

Manufacturer Name : KTM North America, Inc.

Address : 1119 Milan Avenue  
Amherst OH 44001

Company phone : 440-985-3553

**Population :**

Number of potentially involved : 171

Estimated percentage with defect : 1 %

**Vehicle Information :**

Vehicle 1 : 2020-2020 Husqvarna Motorcycle 701 Enduro LR

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

Descriptive Information : - All 2020 Husqvarna 701 Enduro LR are included in the population.  
 -On the affected population, there is a possibility abrasion may occur on both fuel lines located on the front fuel tank.

Production Dates : MAR 05, 2020 - OCT 13, 2020

VIN Range 1 : Begin : VBKUEV404LM795818 End : VBKTR3406LM790768 ☒ Not sequential**Description of Defect :**

Description of the Defect : On affected motorcycles, it is necessary to install two newly designed fuel lines with an additional clamp that position the fuel lines away from the contact points on the front fuel tank that could cause abrasion.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : The presence of a leak could result in the possibility of damage or possible fire, which could cause injury to the rider or others and/or damage to property.

Description of the Cause : The cause of the defect is from the shape and mounting position of the original fuel lines on the front fuel tank.

Identification of Any Warning None  
 that can Occur :

**Involved Components :**

Component Name 1 : Fuel line

Component Description : fuel line tank/coupling

Component Part Number : 60307017000

Component Name 2 : Fuel line clamp

Component Description : variable one-ear clamp 15.7 mm

Component Part Number : 00050157706

Component Name 3 : Clamp

Component Description : RSGU clamp 15/12

Component Part Number : 49007439000

### Supplier Identification :

#### Component Manufacturer

Name : CONTI TECH

Address : NR

Foreign States

Country : Austria

### Chronology :

In December 2020, while performing long-term durability testing by KTM AG R&D, it was determined that a condition exists with the front tank fuel line assembly that may cause abrasions to the lines. As a result, KTM R&D directed KTM AG Quality Control to investigate the cause. In December 2020 KTM AG Quality Control began an investigation into the cause of the occasional abrasions to both fuel lines at the front fuel tank. During a December 2020 end-of-line inspection, KTM AG determined that a recall was needed.

Following the determination R&D and Quality Control evaluated and tested the repair method and line process until April 2021.

### Description of Remedy :

Description of Remedy Program : Two newly-designed fuel lines with a new shape and an additional clamp will be installed.

How Remedy Component Differs from Recalled Component : Replacement parts are identified with a unique newly assigned part number.

Identify How/When Recall Condition was Corrected in Production : In the assembly process, the newly designed parts will be used and installed.

### Recall Schedule :

Description of Recall Schedule : Husqvarna Motorcycles North America is notifying all registered owners of the above-affected motorcycles by mail and all authorized dealers via Husqvarna Dealernet, an internet-based communication portal.

If a consumer previously paid for a repair related to this concern prior to notification, they may request reimbursement by contacting Husqvarna Motorcycles Customer Relations.

Planned Dealer Notification Date : MAY 14, 2021 - JUL 22, 2022

Planned Owner Notification Date : JUN 15, 2021 - AUG 19, 2022

\* NR - Not Reported