

CAMPAIGN LAUNCH STATUS

N598 RECALL 20-22MY DEFENDER- INOPERATIVE REAR TAIL LAMPS



SAFETY RECALL- N598, SMOKED REAR TAIL LAMPS MAY BE INOPERATIVE

AFFECTED MODELS	21-22MY Defender vehicles specified with Smoked Rear Lamp assemblies.	
CURRENT VOLUME AFFECTED	2,622 USA (165 in retailer stock)	255 CAN (59 retailer stock)
REPAIR	Should an intense light source shine directly on the rear of an affected vehicle at a certain angle, the stop, turn signal and/or tail lamp may experience a photovoltaic over-voltage event, and cease to function. Turn signals and stop lamp operation will resume, absent the light source. Tail lamps will remain extinguished until the power feed is cycled. Under the recall repair, all affected vehicles will have the rear lamp assemblies replaced.	
REPAIR TIME	Approx 1.7 hrs	
RECALL NOTIFICATION	Recall repair publication date is TBC. New parts are being manufactured.	
Notes	Bulletins NAS21.06.011 USA and NAS21.06.010 CAN, provide recall notification and an instruction to all retailers to stop the sale of affected vehicles. Port hold also implemented. Customers will be notified by mail before August 3 rd , 2021. Existing part stocks are to be scrapped.	



PRINTED COPIES ARE UNCONTROLLED