

## RECALL 21V444 REMEDY INSTRUCTIONS



Make(s): ALTA TRAVEL TRAILERS  
Model(s): ALT1900MK  
Model Year(s): 2021

Concern:  
The LP/CO detector was installed outside of the manufacturers required height measurement.

Repair Code: RC-075-13-00-004076  
Allotted Time: .50 HRS.  
Inspection Code: N/A  
Allotted Time: N/A  
Photo(s) Required: YES  
Prior Authorization Required: NO  
Part(s) Kit Number: F100190130  
Part(s) Return: N/A

**Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.**

STEP 1: GAIN ACCESS TO THE CURRENT LP/CO DETECTORS WIRES BY REMOVING THE VENTS SHOWN IN FIG. 1;

STEP 2: LOCATE THE NEW LP/CO DETECTOR 4 ½" FROM THE DOOR FRAME AND 4 ½" FROM THE FLOOR SHOWN IN FIG. 2;

STEP 3: SPLICE INTO THE CURRENT LP/CO DETECTOR WIRING AND CONNECT THE NEW LP/CO DETECTOR;

STEP 4: TEST LP/CO DETECTOR FOR FUNCTIONALITY;

STEP 5: CLAIM REPAIR CODE.

FIG. 1



FIG. 2

