OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# 21V-529

Manufacturer Name: Jayco, Inc. **Submission Date:** JUL 13, 2021 NHTSA Recall No.: 21V-529 Manufacturer Recall No.: 9903569



#### **Manufacturer Information:**

Manufacturer Name: Jayco, Inc.

Address: 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone: 800-283-8267

# **Population:**

Number of potentially involved: 890 Estimated percentage with defect: 1 %

**Vehicle Information:** 

Vehicle 1: 2019-2021 Class A Motorhome Anthem Aspire Cornerstone Insignia Reatta Embark

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

**Body Style: OTHER** Power Train: DIESEL

Descriptive Information: Motorized production records match the provided list of window part numbers from

Lippert components.

Production Dates: SEP 17, 2018 - SEP 10, 2020

VIN Range 1: Begin: NR End: NR Not sequential

#### **Description of Defect:**

Description of the Defect: Possible loss of bond between the 2 pieces of glass allowing the vent seal to be

compromised.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Possibility of the window adhesive failing which could result in an injury and/

or a crash.

Description of the Cause: Stress induced failure of window adhesive bonding.

Identification of Any Warning During regular maintenance possibly noticing a loss of bonding.

that can Occur:

# **Involved Components:**

Component Name 1: 6400 Series Vented Window

Component Description: vented Window

**Component Part Number: Various** 

# **Supplier Identification:**

#### **Component Manufacturer**

Name: Lippert Components, Inc.

Address: PO Box 2888

Elkhart Indiana 46515

**Country: United States** 

## **Chronology:**

7-2-21 Lippert Components our supplier sent a notification via email and UPS delivery of recall 21E-047.

7-7-21 Jayco Executive SSC Team voted to publish a recall.

### **Description of Remedy:**

Description of Remedy Program: The remedy program will involve inspecting the involved windows with a

go/no-go gauge to determine if the seal has been compromised. If an issue

is found Lippert will provide a replacement vent.

How Remedy Component Differs The remedy component was produced with the improvements including

from Recalled Component: increasing the bond strength between the two panes of glass through the

use of an adhesive backed glass spacer and different secondary sealant.

Identify How/When Recall Condition On August 3, 2020 Lippert components production processes were

was Corrected in Production: updated to increase the

bond strength between the 2 panes of glass through the use of an adhesive

backed glass spacer.

#### **Recall Schedule:**

Description of Recall Schedule: Jayco to release recall prior to 60 day deadline.

Planned Dealer Notification Date: AUG 16, 2021 - AUG 16, 2021 Planned Owner Notification Date: AUG 16, 2021 - AUG 16, 2021