

Part 573 Safety Recall Report

21V-603

Manufacturer Name : Lamborghini (Automobili Lamborghini)

Submission Date : AUG 05, 2021

NHTSA Recall No. : 21V-603

Manufacturer Recall No. : L636-R.04.21



Manufacturer Information :

Population :

Manufacturer Name : Lamborghini (Automobili Lamborghini)
 Address : Via Modena 12
 Sant'Agata Bolognese (BO) 40019 -
 Italy 00 99999
 Company phone : 999

Number of potentially involved : 224
 Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2021-2021 Automobili Lamborghini Urus
 Vehicle Type : LIGHT VEHICLES
 Body Style : SUV
 Power Train : GAS

Descriptive Information : Vehicles included in this recall may have received certain seat belt assemblies manufactured by certain Autoliv Group companies between October 26, 2020 and January 27, 2021. These specific seat belt assemblies have an automatic locking retractor (ALR) that may deactivate early. Vehicles not included in this recall have received parts that were compliant.

Production Dates : DEC 11, 2020 - JUN 25, 2021

VIN Range 1 : Begin : ZPBUA1ZL7MLA12354 End : ZPBUA1ZL2MLA14982 ☒ Not sequential

Description of Noncompliance :

Description of the Noncompliance : Autoliv has determined that certain seat belt assemblies do not comply with FMVSS 208. In these certain seat belt assemblies, the automatic locking retractor (ALR) function may deactivate early before the webbing is fully retracted.

FMVSS 1 : 208 - Occupant crash protection

FMVSS 2 : NR

Description of the Safety Risk : The ALR function is required in the US market by FMVSS 208 S7.1.1.5. This noncompliance does not impact the compliance or functionality of the seat belt assemblies with respect to their normal use by adult passengers or use of the LATCH system to secure child restraint seats. With child restraint seats for which the vehicle owner elects to use the seat belt to secure the child restraint seat instead of the LATCH system, if the seat belt is not lockable so that the seat belt assembly can be used to tightly secure

the child restraint seat, there is an increased risk of injury in a crash to the occupant of the child restraint seat.

Description of the Cause : The subcomponent supplier of the ALR levers used in the subject seat belt assemblies produced dimensionally out of tolerance parts that may cause the ALR to deactivate before the seat belt webbing is fully retracted.

Identification of Any Warning that can Occur : A vehicle owner who elects to use the seat belt instead of the LATCH system to secure a child restraint seat will notice that the audible clicking noise made when the ALR function is activated stops well before the seat belt webbing is fully retracted.

Involved Components :

Component Name 1 : Seat belt assembly

Component Description : Seat belt assembly rear middle position

Component Part Number : 4M8857807A (color variants: 18N Umber, 76R Red, R88 Brown, RL8 Grey, V04 Black)

Supplier Identification :

Component Manufacturer

Name : Autoliv, Inc.

Address : Klarabergsviadukten 70
World Trade Center Stockholm Foreign States 28326

Country : Sweden

Chronology :

July 07, 2021 Lamborghini was informed that Autoliv has decided to recall certain seat belt assemblies manufactured between October 26, 2020 and January 27, 2021 by certain Autoliv Group companies due to a potential non-compliance with FMVSS 208 in US. Lamborghini started discussion with Autoliv in order to understand the issue and the potential non-compliance, the technical background and asked Autoliv to provide the built-data for the suspect seat belt assemblies so that Lamborghini can start to identify the affected VINs. Internal analysis started.

July 2021: Ongoing discussions with Autoliv in order to understand potential non-compliance. Technical details requested. Autoliv stated that topic is not safety related but a non-compliance with FMVSS. Evaluation about potential relevance for motor vehicle safety started.

July 14, 2021: Autoliv informed about a discussion with NHTSA and again stated Autoliv's position that this topic is not safety related.

July 28, 2021: Topic was presented in Lamborghini Product Safety Committee. Lamborghini evaluated that this topic poses no unreasonable risk to motor vehicles safety but is a potential non-compliance with FMVSS 208 in Lamborghini vehicles and decided a non-compliance recall.

Description of Remedy :

Description of Remedy Program : Dealers will inspect the affected seat belt assemblies at the specific seating positions and, if necessary, replace an affected seat belt free of charge. Because the affected vehicles are within the New Vehicle Limited Warranty, Lamborghini will not offer a reimbursement plan under this recall.

How Remedy Component Differs from Recalled Component : The remedy component is built outside of the potentially affected time period and the ALR function is working. The recalled parts are the seat belt assemblies for the middle rear seat. The recalled part numbers are the same as the remedy part numbers:
Rear middle position: 4M8857807A
4M8857807A18N Umber
4M8857807A76R Red
4M8857807AR88 Chestnut brown
4M8857807ARL8 Dark grey
4M8857807AV04 Black

Identify How/When Recall Condition was Corrected in Production : Autoliv reported that this issue was corrected in production at their supplier January 2021.

Recall Schedule :

Description of Recall Schedule : Dealers/Owners: On or before October 01, 2021

Planned Dealer Notification Date : OCT 01, 2021 - OCT 01, 2021

Planned Owner Notification Date : OCT 01, 2021 - OCT 01, 2021

* NR - Not Reported