

Part 573 Safety Recall Report

21V-613

Manufacturer Name : Maserati North America, Inc.**Submission Date :** AUG 05, 2021**NHTSA Recall No. :** 21V-613**Manufacturer Recall No. :** 432**Manufacturer Information :**

Manufacturer Name : Maserati North America, Inc.

Address : One Chrysler Drive

Auburn Hills MI 48326

Company phone : 877-969-2737

Population :

Number of potentially involved : 125

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2021-2021 MASERATI Quattroporte Trofeo

Vehicle Type :

Body Style : 4-DOOR

Power Train : NR

Descriptive Information : Some 2021 MY Quattroporte Trofeo vehicles equipped with certain optional 21 inch tires may have incorrect inflation pressure indicated on the tire placard for the maximum load capacity per axle.

The suspect period was determined, using vehicle production records, to be some 2021 MY Maserati Quattroporte V8 Trofeo vehicles built from the beginning of MY 2021 production through April 27, 2021, when the vehicle assembly placard part numbers were updated in the Maserati system. Similar vehicles that are not included in the recall were built before or after the suspect period or were built with different tires than the suspect tires.

The total affected vehicles for this model is 44

Production Dates : DEC 31, 2020 - APR 27, 2021

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 2 : 2021-2021 MASERATI Ghibli Trofeo

Vehicle Type :

Body Style : 4-DOOR

Power Train : NR

Descriptive Information : Some 2021 MY Ghibli Trofeo vehicles equipped with certain optional 21 inch tires may have incorrect inflation pressure indicated on the tire placard for the maximum load capacity per axle.

The suspect period was determined, using vehicle production records, to be some 2021 MY Maserati Ghibli V8 Trofeo vehicles built from the beginning of MY2021 production through June 21, 2021, when the vehicle assembly placard part numbers were updated in the Maserati system. Similar vehicles that are not included in the recall were built before or after the suspect period or were built with different tires than the suspect tires.

The total affected vehicles for this model is 81.

Production Dates : SEP 11, 2020 - JUN 21, 2021

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Noncompliance :

Description of the Noncompliance : Federal Motor Vehicle Safety Standard ("FMVSS") 49 CFR 571.110 S4.3.4 requires manufacturers to provide inflation pressure for the maximum load capacity per axle on the placard. Inflation pressures listed on the tire placards of certain models are below the required values.

FMVSS 1 : 110 - Tire selection and rims

FMVSS 2 : NR

Description of the Safety Risk : Failure to inflate tires to the appropriate pressure when the vehicle is fully loaded could result in unexpected handling characteristics or sudden air pressure loss which could cause a vehicle crash without prior warning.

Description of the Cause : NR

Identification of Any Warning that can Occur : None

Involved Components :

Component Name 1 : Tire Placard Labels

Component Description : Pressure Tire Labels

Component Part Number : 670007376

Supplier Identification :

Component Manufacturer

Name : AGAP Maserati Plant
Address : via Alfieri Maserati 65
10095 Grugliasco Torino Foreign States
Country : Italy

Chronology :

On July 28, 2021, Maserati S.p.A Vehicle Safety and Regulatory Compliance Group received information that MY 2022 and MY 2021 Quattroporte Trofeo and Ghibli Trofeo vehicles were built with 21 inch tires placard labels with pressure values for MY19 and MY20 vehicles.

On July 29, 2021, Maserati SpA determined, through the Vehicle Regulation Committee, to conduct a voluntary safety recall of the affected vehicles for the noncompliance of FMVSS 110.

Description of Remedy :

Description of Remedy Program : Maserati will replace the placard with corrected labels and update the TPMS.
Maserati North America has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, Maserati North America, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.

How Remedy Component Differs from Recalled Component : New design part and new part number.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : 8/05/2021: Maserati North America, Inc., will notify dealers and begin notifying owners on or about 09/17/2021.
Planned Dealer Notification Date : SEP 17, 2021 - SEP 17, 2021
Planned Owner Notification Date : SEP 17, 2021 - SEP 17, 2021

* NR - Not Reported