Reference Bulletins: QB R10112

Polestar on behalf of Polestar Performance AB, have decided to launch Recall R10112 on certain model year 2021 Polestar 1 vehicles. Only two VINS are affected by Recall R10112. Volvo Cars investigations have identified that there may be a risk that certain seat belts with the Automatic Locking Retractor (ALR) have not been produced according to specifications and may result in early deactivation of the locking feature used to tightly secure a child restraint system/seat. The subject seat belt assemblies have a feature that converts the retractor from an emergency locking retractor (ELR) to an automatic locking retractor. The seat belts convert to the ALR mode after the webbing has been fully withdrawn from the retractor. The system is designed so that as the seat belt is released into the retractor, the ALR function remains active so a child restraint seat can be tightly secured. However, in certain seat belt assemblies the ALR function deactivates early before the webbing is fully retracted.

This noncompliance does not impact the compliance or functionality of the seat belt assemblies with respect to their normal use by adult passengers or use of the LATCH system to secure child restraint seats.

While using child restraint seats, which the vehicle owner elects to use the seat belt to secure the child restraint seat instead of the LATCH system, if the seat belt is not lockable, there is an increased risk of injury in a crash to the occupant of the child restraint seat.

The corrective action is to inspect and perform a functionality test. If necessary, the affected seat belts will be replaced with a seat belt assembly that contains ALR levers that were manufactured according to production specifications.

Parts Bulletin 88-R10112



The following part numbers apply:

Part Number	Description	Qty
31675302	Seat Belt Front RH Yellow	1
32137209	Total Upgrade PS1	1
32283143	SWDL RML/RMR Reload PS1	1
985047	Flange screw	1

Page 2 of 2 2021-09-29