Part 573 Safety Recall Report

Manufacturer Name :Jayco, Inc.Submission Date :SEP 30, 2021NHTSA Recall No. :21V-762Manufacturer Recall No. :9901571

Manufacturer Information :

Manufacturer Name : Jayco, Inc. Address : 903 South Main Street PO Box 460 Middlebury IN 46540 Company phone : 800-283-8267

Vehicle Information :

Vehicle 1:	2021-2022 JAYCO JAY FEATHER, JAY FLIGHT SLX		
Vehicle Type :	TRAILERS		
Body Style :			
Power Train :	NR		
Descriptive Information :	ation : MY 2021 JAY FEATHER - 151 UNITS		
	MY 2021-2022 JAY FLIGHT SLX - 1896 UNITS		
Production Dates :	MAY 28, 2020 - SEP 27, 2021		
VIN Range 1:	Begin :1UJBJOAJ7M77J9000End :1UJBJOAJXN17B0405Image: Not sequential		
VIN Range 1:	Begin : 1UJBJ0AJ7M77J9000 End : 1UJBJ0AJXN17B0405 🔽 Not sequential		

Population :

Description of Defect :

-				
Description of the Defect :	Flame on the cook top will invert when the furnace is running.			
FMVSS 1 :	NR			
FMVSS 2 :	NR			
Description of the Safety Risk :	When the furnace and cooktop are operated at the same time the cooktop burner flame can invert leading to an increased risk of personal injury or fire.			
Description of the Cause :	The cooktop is installed in a cabinet that is not sealed from the furnace area.			
Identification of Any Warning that can Occur :	An inverted flame may be observed on the cooktop.			
Involved Components :				
The information contained in this report was submitted pursuant to 49 CFR §573				



Number of potentially involved : 2,047 Estimated percentage with defect : 100 %

Part 573 Safety Recall Report

21V-762

Component Name 1 : NR Component Description : NR

Component Part Number: NR

Supplier Identification :

Component Manufacturer

Name : NR Address : NR NR Country : NR

Chronology :

On July 12, 2021 Jayco received a complaint alleging the flame on the stove inverted when the furnace and stove were running. This was investigated by WIRC and when it was discussed on 8/23/21, the Warranty Incident Review Committee decided to elevate the incident to CPAC. The Corrective and Preventive Action Committee reviewed this allegation on 9/1/21. CPAC determined that a change was made from a Dometic furnace to a Suburban furnace which had a higher output causing negative pressure resulting in the inversion of the flame when the stove and Suburban furnace operated at the same time. An investigation began to identify which units had the change made to the furnace and could exhibit this condition. Four more similar allegations were identified from our records. During the 9/15/21 CPAC meeting it was decided to elevate this incident to SSC. On 9/23/21, the Safety Steering Committee met and voted to proceed with a safety recall for this incident.

Description of Remedy :

Description of Remedy Program :	Sealant and plywood panels will be used to seal the area around the gas line hose and the area adjoining the cooktop. On some units, plywood panels will be installed to separate the furnace and cooktop. This remedy will be done at no cost to the owner. Prenotification remedy will be handled by our recall reimbursement plan on file with NHTSA.
How Remedy Component Differs from Recalled Component :	Sealant will be visible in the area around the gas line hose and the area adjoining the cooktop.

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

Identify How/When Recall Condition
was Corrected in Production :Sealant and plywood panels were used to seal the area around the gas line
hose and the area adjoining the cooktop beginning 9/27/2021

Recall Schedule :

Description of Recall Schedule :	Jayco will notify the dealers and owners of these recreational vehicles by letter. A final copy of the owner letter and dealer repair instructions will be provided to NHTSA.
Planned Dealer Notification Date :	NOV 29, 2021 - NOV 29, 2021
Planned Owner Notification Date :	NOV 29, 2021 - NOV 29, 2021

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573