

Part 573 Safety Recall Report

21V-777

Manufacturer Name : Aluma KLM
Submission Date : OCT 06, 2021
NHTSA Recall No. : 21V-777
Manufacturer Recall No. : NR

**Manufacturer Information :**

Manufacturer Name : Aluma KLM
Address : 101 E. SENECA ROAD
 PO BOX 287 BANCROFT IA 50517
Company phone : 999

Population :

Number of potentially involved : 160
Estimated percentage with defect : NR

Vehicle Information :

Vehicle 1 : 2021-2021 Trailer 8214HSTILT
Vehicle Type : TRAILERS
Body Style : OTHER
Power Train : NR

Descriptive Information : This recall has been generated to inform Aluma dealers and trailer owners that trailer model 8214HSTILT may have a potential for the tilt angle mounting bracket to come loose. The latch pin on the tongue may potentially disengage and can cause the tilt bed to be able to lift up. Customer complaints initiated internal inspection of completed trailers on Bancroft site. Aluma shipping personnel noticed that front latch mounting angle bracket on trailer model 8214HSTILT had potential to not remain tightened while inspecting trailers. Contained to trailer model 8214HSTILT manufactured this year 2021 with potential of 160 internal and external trailers.

Production Dates : FEB 03, 2021 - SEP 24, 2021

VIN Range 1 : Begin : 1YGHD1414NB233649 **End :** 1YGHD1419NB245229 Not sequential

Description of Defect :

Description of the Defect : Trailer model 8214HSTILT manufactured this year 2021 has mounting hardware defect with front latch rivet nuts not remaining secure causing angle mounting bracket to become loosening.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Front latch angle mounting bracket rivet nuts not remaining secure causes angle mounting bracket to become loose. Tongue mount latch pin can potentially become disengaged from mounting bracket causing tilt of trailer bed.

Description of the Cause : NR

Identification of Any Warning that can Occur : Front latch mounting bracket not secured firmly to front of trailer side frame.

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

First recorded customer complaint was on September 13, 2021, an Aluma trailer owner contacted service personnel of loose mounting bracket looking for support on correcting problem.

Description of Remedy :

Description of Remedy Program : Mounting holes for rivet nuts were drilled oversized causing rivet nuts to become loose in mounting hole causing front latch angle mounting bracket to come loose.

How Remedy Component Differs from Recalled Component : Equipment calibration and internal manufacturing defect. Oversized mounting holes. Change hardware used to secure angle mounting bracket.

Identify How/When Recall Condition was Corrected in Production : Shipping personnel inspected all existing internal stock and all new manufactured trailers incorporated new hardware for securing angle mounting bracket. A service bulletin was generated and manufacturing personnel was instructed on new mounting hardware used to secure angle mounting bracket. September 13, 2021

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

* NR - Not Reported