OMB Control No.: 2127-0004

Part 573 Safety Recall Report

21V-793

Manufacturer Name: Winnebago Industries, Inc.

NHTSA Recall No.: 21V-793

Manufacturer Recall No.: 164



Manufacturer Information:

Manufacturer Name: Winnebago Industries, Inc.

Address: PO BOX 152

605 W. Crystal Lake Rd. Forest City IA

50436

Company phone: 1-641-585-3535

Population:

Number of potentially involved: 267 Estimated percentage with defect: 100 %

Vehicle Information:

Vehicle 1: 2019-2022 Winnebago Travato

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Population was determined by receiving a serialized component list provided by

Volta Power Systems LLC. Three of the total Travato population were identified in

model year 2019, two in model year 2020, four in model year 2021, and the

remaining are model year 2022.

Production Dates: SEP 19, 2018 - OCT 01, 2021

VIN Range 1: Begin: NR End: NR

Not sequential

Vehicle 2: 2021-2022 Winnebago Boldt

Vehicle Type : Body Style : Power Train : NR

Descriptive Information: Population was determined by receiving a serialized component list provided by

Volta Power Systems LLC. Three of total Boldt population were identified in model

year 2021, the remaining are model year 2022.

Production Dates : APR 02, 2021 - OCT 01, 2021

Description of Defect:

Description of the Defect: An incorrectly built wire harness resulted in the loss of overcurrent protection.

FMVSS 1: NR FMVSS 2: NR Description of the Safety Risk: Loss of overcurrent protection can cause wires to overheat, resulting in a

thermal event. Owners are instructed to not drive their vehicle until the Volta

system is disabled.

Description of the Cause: NR

Identification of Any Warning NR

that can Occur:

Involved Components:

Component Name 1: Wire Harness

Component Description: Alternator Control Wire Harness

Component Part Number: 100001146

Supplier Identification:

Component Manufacturer

Name: Volta Power Systems LLC.

Address: 12550 Superior Court

Holland Michigan 50436

Country: United States

Chronology:

On Thursday September 30, 2021 Winnebago Product Compliance was made aware of a vehicle fire which was a Travato in delivery. No injuries or property damage was reported. An immediate investigation was launched. Winnebago retained a fire and electrical experts, each arriving on Thursday October 7th. Upon completion of their investigation, the potential source was determined to be in a section of wire harness supplied by Volta Power Systems LLC. Winnebago Product Safety Committee met on Thursday October 7th and decided to issue a voluntary recall of the affected units. On Monday October 11th representatives from Volta arrived and conducted an investigation, which identified loose wire connections and verified the harness previously identified was built incorrectly by one of their suppliers.

Description of Remedy:

Description of Remedy Program: Winnebago Motorhomes will coordinate the harness replacement and

electrical connection inspection of units identified in this recall. Remedy will be performed by Winnebago Dealers at no cost to the consumer. If a consumer has paid to remedy this issue, they may be eligible for reimbursement. Reimbursement information can be obtained by

contacting Winnebago Customer Care.

How Remedy Component Differs Proper overcurrent protection has been properly located in the harness

from Recalled Component : and added quality checks have been added to ensure proper electrical

connections are made.

Identify How/When Recall Condition The recall condition is corrected in production by using a harness with

was Corrected in Production: over current protection properly located and added process

improvements to ensure connections are correct. This has been corrected

at the supplier.

Recall Schedule:

Description of Recall Schedule: Notification will be sent within the 60 day requirement

Planned Dealer Notification Date: OCT 29, 2021 - OCT 29, 2021 Planned Owner Notification Date: OCT 29, 2021 - OCT 29, 2021

^{*} NR - Not Reported