

# Part 573 Safety Recall Report

## 22E-004

**Manufacturer Name :** Prevost Car (US) Inc.

**Submission Date :** JAN 24, 2022

**NHTSA Recall No. :** 22E-004

**Manufacturer Recall No. :** NR



### Manufacturer Information :

Manufacturer Name : Prevost Car (US) Inc.

Address : 260 Banker Road  
PLATTSBURGH NY 12901

Company phone : 999

### Population :

Number of potentially involved : 62

Estimated percentage with defect : 100 %

### Equipment Information :

Brand / Trade 1 : Non applicable

Model : Non applicable

Part No. : 860351 & 860355

Size : NR

Function : Seat bracket

**Descriptive Information :** Seat bracket, which is a single structure component, designed for entertainer vehicles were manufactured based on a defective drawing. The final product did not fulfilled the strength requirements.

Vehicles affected for this P/N issue are entertainers equipped with passenger seatbelts anchored to the seat. (Shell vehicles) MY2020 to MY2022.

**Production Dates :** JAN 01, 2020 - JAN 01, 2022

### Description of Defect :

**Description of the Defect :** Seat bracket for entertainer vehicles are not strong enough to support design mechanical loads

FMVSS 1 : 210 - Seat belt assembly anchorages

FMVSS 2 : NR

**Description of the Safety Risk :** Potential injury of passengers in case of crash.

Prevost has not received a report of death or injury associated with this defect. Therefore we consider this as a proactive measure to protect the public from the potential risk associated with this defect.

**Description of the Cause :** Design related defect

**Identification of Any Warning that can Occur :** Non applicable

**Involved Components :**

Component Name : Seat bracket

Component Description : 0.1" thick steel sheet cut and welded 1.5" x 1.5" x 6"

Component Part Number : 860351 & 860355

**Supplier Identification :****Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

**Chronology :**

- 2021-12-22: Issue was reported to Product Safety Manager
- 2022-01-11: Case submitted for investigation to Product Safety Working Group (PSWG) as a potential safety related issue
- 2022-01-18: Case raised to the Product Safety Committee (PSC). PSC determines that a safety defect exists.

**Description of Remedy :**

Description of Remedy Program : A safety recall will be released to replace the defective brackets with new reinforced brackets compliant with the design loads. Owner letters will be mailed on or before March 21st, 2022.

How Remedy Component Differs from Recalled Component : New brackets will look the same as old brackets but, they will have an additional welding

Identify How/When Recall Condition was Corrected in Production : Bracket drawing was updated to show the missing welding and was released for production.

**Recall Schedule :**

Description of Recall Schedule : Note Prevost does not have a dealer network and the dates entered for the planned dealer notification begin/end date are only to avoid NHTSA Recall Portal error while submitting the recall report.

Planned Dealer Notification Date : MAR 21, 2022 - MAR 21, 2022

Planned Owner Notification Date : MAR 21, 2022 - MAR 21, 2022

### Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name : NR

Address : NR

NR

Country : NR

Company Phone : NR

\* NR - Not Reported