

Part 573 Safety Recall Report

22E-036

Manufacturer Name : Performance Machine, Inc.**Submission Date :** APR 29, 2022**NHTSA Recall No. :** 22E-036**Manufacturer Recall No. :** NR**Manufacturer Information :****Population :****Manufacturer Name :** Performance Machine, Inc.**Number of potentially involved :** 533**Address :** 16121 Carmenita Road
Cerritos CA 90703**Estimated percentage with defect :** NR**Company phone :** 714-523-3000**Equipment Information :****Brand / Trade 1 :** Burly Brand**Model :** Dominator**Part No. :** see descriptive info**Size :** 10 in., 12 in., 14 in. heights**Function :** MC handlebar

Descriptive Information : The following 12 part numbers are affected;

- B12-6051B Dominator Raked, 10" Black
- B12-6051SB Dominator Raked, 10" Satin Black
- B12-6052B Dominator Raked, 12" Black
- B12-6052SB Dominator Raked, 12" Satin Black
- B12-6053B Dominator Raked, 14" Black
- B12-6053SB Dominator Raked, 14" Satin Black
- B12-6071B Dominator Straight, 10" Black
- B12-6071SB Dominator Straight, 10" Satin Black
- B12-6072B Dominator Straight, 12" Black
- B12-6072SB Dominator Straight, 12" Satin Black
- B12-6073B Dominator Straight, 14" Black
- B12-6073SB Dominator Straight, 14" Satin Black

Production Dates : NOV 25, 2020 - APR 29, 2022**Description of Defect :**

Description of the Defect : The weld that attaches the threaded inserts to the tube of the uprights, (the attachment point to the top clamp) may not be welded per the designed specification. This is a "defect" and NOT a "FMVSS non compliance"

FMVSS 1 : NR**FMVSS 2 :** NR

Description of the Safety Risk : Some percentage of welds do not meet our drawing specification. Such welds can crack and lead to separation of handlebars from the top clamp of the motorcycle, and may cause loss of control of motorcycle.

Description of the Cause : Manufacturing variances of weld size and thickness

Identification of Any Warning that can Occur : Warnings such as excessive looseness or play in the handlebars may occur.

Involved Components :

Component Name : n/a

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : Performance Machine, LLC

Address : 16121 Carmenita Road, Cerritos, CA 90703
Cerritos California 90703

Country : United States

Chronology :

Received product concern report 4/19/22 for PN B12-6073SB, showing cracked welds and separation at attachment point.

Action taken 4/20/22, put Dominator handlebars on hold, notified distributors to return unsold product.

Began 100% QC process of all unsold/held inventory; began fatigue testing new stock to determine scope of recall and how to identify affected models.

Received product concern report 4/26/22 for PN B12-6072B, showing cracked welds at attachment point.

Received product concern report 4/29/22 for PN B12-6073SB, showing cracked welds at attachment point.

Description of Remedy :

Description of Remedy Program : NR

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition
was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR
Planned Dealer Notification Date : NR - NR
Planned Owner Notification Date : NR - NR

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name : NR
Address : NR
NR
Country : NR
Company Phone : NR

* NR - Not Reported