# **SERVICE BULLETIN**



2022-10-14

#### M1561

# M1561: RECALL 0633 - DETACHABLE TOUR-PAK CONVERSION KIT

# **Reason for Revision**

Refer to Table 1.

#### Table 1. Document History

|            | · · · · · · · · · · · · · · · · · · ·    |  |  |  |  |  |
|------------|--|--|--|--|--|--|
| Date       | Revision Description                     |  |  |  |  |  |
| 2022-10-14 | Delivery date has been updated.          |  |  |  |  |  |
| 2022-10-14 | * Updated Part Numbers                   |  |  |  |  |  |
| 2022-10-05 | Recall Kit information has been updated. |  |  |  |  |  |
| 2022-10-03 | * Updated Credit Procedure               |  |  |  |  |  |
| 2022-10-03 | Recall Kit information has been updated. |  |  |  |  |  |
| 2022-10-03 | * Updated Credit Procedure               |  |  |  |  |  |
| 2022-08-19 | Initial release                          |  |  |  |  |  |
|            |  |  |  |  |  |  |

# **Purpose for Service Bulletin**

This bulletin informs dealers that Harley-Davidson has discovered that when Parts and Accessories (P&A) Detachable Tour-Pak Luggage Carrier Conversion Kits (Part No's. 53000916 and 53000917) are installed on 2014-2022 Touring and CVO Touring motorcycles, that these conversion kits may fail to conform to the Federal Motor Vehicle Safety Standard (No. 108; Lamps, Reflective Devices and Associated Equipment).

Specifically, if the Tour-Pak is removed and the vehicle is operated while one of these kits is installed, the green turn signal indicator will Fast Flash regardless of the functionality of the turn signal lights. As a consequence, if a turn signal light does subsequently malfunction, there is no change in flashing rate of the indicator within the instrument cluster as required by FMVSS 108 S9.3.6.

# Motorcycles Affected

2014-2022 Touring and CVO Touring vehicles

## Markets Affected

United States, Canada, and Mexico.

## Part Numbers

Parts are currently unavailable. Harley-Davidson is planning on Recall Kits (Part No. 91500111) to be available to order on January 9th, 2023.

Refer to Table 2.

#### Table 2. Affected Detachable Tour-Pak Part Numbers


| Part No. | Item Description                 |  |  |  |  |
|----------|----------------------------------|--|--|--|--|
| 53000916 | Kit, Detachable Tour-Pak, black  |  |  |  |  |
| 53000917 | Kit, Detachable Tour-Pak, chrome |  |  |  |  |

#### Table 3. Kit Number

|                               | Recall Kit Part No. |
|-------------------------------|---------------------|
| Kit, Recall, Tour-Pak Harness | 91500111            |

# **Required Dealer Action**

#### Table 4.

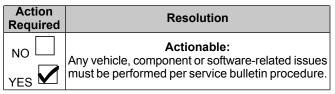

- Display Recall 0633 Poster to Customers. 1.
  - Retrieve Recall 0633 poster from Service Information а Portal (SIP) via (Recall\_0633\_Poster).
  - Print Recall 0633 poster. b.
  - Display notice poster prominently in the customer C. area.
- 2. Verify that all dealer inventory kits have been addressed per this Service Bulletin.
- Remove current harness from the P&A Detachable kit 3. installed.
  - Remove main fuse. a.
  - b. Remove seat.
  - Remove left saddlebag. C.
  - Remove right saddlebag. d.
  - Remove cable straps securing Tour-Pak harness e. (Part No. 69202326).
  - f. Disconnect four wiring connectors.

NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

| ROUTING      | SERVICE<br>MANAGER | SALES MANAGER | PARTS MANAGER | WARRANTY<br>PROCESS<br>MANAGER | LEAD TECHNICIAN | TECHNICIAN NO. 1 | TECHNICIAN NO. 2 | TECHNICIAN NO. 3 | RETURN THIS TO |
|--------------|--------------------|---------------|---------------|--------------------------------|-----------------|------------------|------------------|------------------|----------------|
| INITIAL HERE |                    |               |               |                                |                 |                  |                  |                  |                |

- g. Remove harness (Part No. 69202326) from vehicle's Tour-Pak.
- 4. Install replacement harness from Recall Kit (Part No. 91500111) to vehicle's Tour-Pak.
  - a. Connect four wiring connectors for new harness to currently installed kit.
  - b. Install cable straps to secure harness.
  - c. Install right saddlebag.
  - d. Install left saddlebag.
  - e. Install seat. After installing seat, pull up on seat to verify it is secure.
  - f. Install main fuse.
- 5. Verify turn signal operation on vehicle.

# **Dealer Inventory Instructions**

- 1. Locate all P&A Detachable Tour-Pak Luggage Conversion Kits (Part No's. 53000916 and 53000917).
- 2. Remove kits from inventory.
- 3. Order harness Recall Kit (Part No. 91500111) for each conversion kit.
- 4. Remove Tour-Pak harness (Part No. 69202326) from kit.
- 5. Insert replacement harness from Recall Kit (Part No. 91500111) into each kit.
- 6. Add back into inventory.

# **Credit Procedure**

Parts are currently unavailable. Harley-Davidson is planning on Recall Kits (Part No. 91500111) to be available to order on January 9, 2023.

Credit procedure will be updated with a Credit Table when Recall Kit (Part No. 91500111) is released for ordering. Due to supply chain concerns, Harley-Davidson has moved the expected availability of the Recall Kit from October 1, 2022 and is currently planning for January 9, 2023.