Part 573 Safety Recall Report

Manufacturer Name :Iowa Mold Tooling Co., Inc.Submission Date :0CT 06, 2022NHTSA Recall No. :22E-067Manufacturer Recall No. :TB2022001 - IMT dist

Manufacturer Information :

Manufacturer Name : Iowa Mold Tooling Co., Inc. Address : 500 Highway 18 West P.O. Box 189 Garner IA 50438 Company phone : 1-800-247-5958

Equipment Information :

Decend / Transla 1	D/T
Brand / Trade 1 :	
Model :	42684
Part No. :	6390121
Size :	NR
Function :	NR
Descriptive Information :	The recall population includes all IMT Model 42684 Loaders from the start of production until a welding process change was implemented. IMT is the importer of the hydraulic loading crane and components which are later supplied to upfitters for installation on an incomplete vehicle.
Production Dates :	JAN 01, 2018 - JUL 01, 2022

Description of Defect :

Description of the Defect :	Certain IMT model 42684 hydraulic loaders have stabilizer beams with welds that over time can crack and break under load.	
FMVSS 1 :	NR	
FMVSS 2 :	NR	
Description of the Safety Risk :	If the cracks in the weld of the stabilizer beam are not addressed, they could progress and eventually cause the stabilizer beam to break. If the stabilizer beam breaks when the hydraulic loader is being operated, it may lead the the vehicle to tip while lifting a load or to disengage the load, increasing the risk of property damage or injury.	
Description of the Cause :	Insufficient welding during production of the stabilizer beams.	
Identification of Any Warning that can Occur :	Cracks may be visible in the stabilizer beam.	
The information contained in this report was submitted pursuant to 49 CFR §573		



22E-067

Population :

Number of potentially involved :32Estimated percentage with defect :100 %

Part 573 Safety Recall Report

Involved Components :

Component Name :	Stabilizer beam
Component Description :	Stabilizer
Component Part Number :	6390121

Supplier Identification :

Component Manufacturer

Name : HMF Address : Oddervej 200, DK-8270 Højbjerg Foreign States Country : Denmark

Chronology :

Jan 2022 Tech Support received an email from a customer with photos of a broken stabilizer beam. At the time it was deemed to be an isolated incident.

May 2022 Tech Support received an email from a 2nd customer with photos of broken stabilizer beam. This unit indicated an apparent lack of basic maintenance in that the retaining bolts for a mechanical stop on the stabilizer were missing. Missing retaining bolts would have allowed the stabilizer to extend beyond the designed distance for travel, therefore increasing the load moment applied to the beam, possibly contributing to the failure. Nevertheless, the decision was made to have the beam returned for analysis to assure full understanding of the failure mode and to involve the supplier of the stabilizer beam, located in Denmark.

July 2022 While the investigation remained ongoing, Tech Support received photos of a broken stabilizer beam on a new unit that was undergoing final stability testing before being released to the field. These photos were forwarded to the supplier in Denmark and because the failure occurred on a new unit, an emphasis was placed on the review of the weld profile and failure appearance.

Aug 2022 Duirng the investigation, the component supplier in Denmark conducted tests on sample components in their inventory. In August, 2022, the supplier was able to identify an issue with the weld process that resulted in a weld of inadequate strength. An updated process was implemented to produce all new parts with expected strength and on August 10, 2022, IMT decided to conduct a safety-related recall to address units in the field. IMT is not aware of any injuries or damage that occurred as a result of the performance of the stabilizer beams in the field.

Description of Remedy :

Description of Remedy Program :	The remedy consists of replacing the stabilizer beams with new ones that are produced with an updated welding process.
	The procedure will be performed by an IMT distributor service technician at no cost to the customer, and should take less than 8 hours to perform. The vehicle owner may file a warranty claim to IMT for reimbursement of parts & labor.
	The remedy component will include welds produced following the implementation of an improved welding process.
	In August 2022 the component supplier implemented a new welding process to assure adequate strength.

Recall Schedule :

Description of Recall Schedule :	IMT will notify purchasers of the hydraulic loading system of the recall.
	The final stage manufacturer will notify vehicle owners. IMT's 577
	Dealer letter will be mailed pending NHTSA approval.
Planned Dealer Notification Date :	SEP 23, 2022 - SEP 23, 2022
Planned Owner Notification Date :	NR - NR

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name :	Custom Truck & Equipment, LLC
Address :	7701 E 24 HWY
	KANSAS CITY MO 64125
Country :	US
Company Phone :	8162414888
Name :	I-STATE TRUCK CENTER
Address :	1505 S CENTRAL AVE
	MARSHFIELD WI 54449
Country :	US
Company Phone :	7153872545

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

Name :CRANEWORKS, INC.Address :7795 LITTLE YORK ROADHouston TX 77016USCompany Phone :9082745586

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573

22E-067