

# Part 573 Safety Recall Report

## 22V-024

**Manufacturer Name :** Nissan North America, Inc.

**Submission Date :** JUL 15, 2022

**NHTSA Recall No. :** 22V-024

**Manufacturer Recall No. :** R21B9



### Manufacturer Information :

**Manufacturer Name :** Nissan North America, Inc.

**Address :** P. O. BOX 685001

Franklin TN 37068-5009

**Company phone :** 800-647-7261

### Population :

**Number of potentially involved :** 688,946

**Estimated percentage with defect :** 1 %

### Vehicle Information :

**Vehicle 1 :** 2014-2016 Nissan Rogue

**Vehicle Type :** LIGHT VEHICLES

**Body Style :** SUV

**Power Train :** GAS

**Descriptive Information :** Based on production records, this issue is unique to these models and dates of manufacture listed above. Nissan Rogue vehicles manufactured after this date are unaffected because a change was made after MY 2016 at each of the plants to remove the harness tape. No other Nissan or INFINITI vehicles are affected because the harness layout and tape used are specific to the Nissan Rogue.

**Production Dates :** JUL 25, 2013 - DEC 31, 2016

**VIN Range 1 : Begin :**

NR

**End :** NR

Not sequential

### Description of Defect :

**Description of the Defect :** In affected vehicles, if water and salt collect in the driver's side foot well, it may wick up the dash side harness tape and enter the connector.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** If the connector becomes corroded, electrical current may continue to flow between the connector terminals, potentially causing the driver's power seat or power window to become inoperative, AWD warning light illumination, battery discharge, and/or thermal damage to the connector. In the worst case condition, a fire can occur.

**Description of the Cause :** NR

**Identification of Any Warning that can Occur :** The customer may experience one or more of the following conditions: Driver's power window or power seat inoperative, AWD warning light illuminated, battery discharge, a burning odor, or smoke under the driver side dash.

**Involved Components :**

Component Name 1 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-4BA0A

Component Name 2 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-4BA0B

Component Name 3 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-4BA0C

Component Name 4 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-6FL0B

Component Name 5 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-6FL0D

Component Name 6 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-6FL0E

Component Name 7 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-9TB0B

Component Name 8 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-9TBOC

---

Component Name 9 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-9TB6A

---

Component Name 10 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-9TB6B

---

Component Name 11 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-9TB6C

---

Component Name 12 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-9TB7B

---

Component Name 13 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-9TB7C

---

Component Name 14 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HA0A

---

Component Name 15 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HA0B

---

Component Name 16 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HA0C

---

Component Name 17 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HA1A

---

Component Name 18 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HA1B

---

Component Name 19 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HJOA

---

Component Name 20 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HJ1A

---

Component Name 21 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HK0B

---

Component Name 22 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HK0D

Component Name 23 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HK0E

Component Name 24 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-5HK1E

## Supplier Identification :

### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

## Chronology :

See attached Part 573 report for chronology.

## Description of Remedy :

Description of Remedy Program : Owners will be instructed to bring their vehicle into a Nissan dealer for inspection, where the dealer will perform one of the following repairs:

If corrosion is present on either of the connectors, the dealer will remove the foam tape and harness covering, replace both connectors and apply white lithium grease to the connectors.

If corrosion is not present on either of the connectors, the dealer will remove the foam tape and harness covering and apply white lithium grease to the connectors.

Nissan will include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy since the subject vehicles are no longer under warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

## Recall Schedule :

Description of Recall Schedule : Dealers will be notified beginning January 25, 2022. Owners of all potentially affected vehicles will receive an interim notification beginning on March 2, 2022.

Planned Dealer Notification Date : JAN 25, 2022 - NR

Planned Owner Notification Date : MAR 02, 2022 - NR

\* NR - Not Reported