

Part 573 Safety Recall Report

22V-024

Manufacturer Name : Nissan North America, Inc.

Submission Date : SEP 28, 2022

NHTSA Recall No. : 22V-024

Manufacturer Recall No. : R21B9



Manufacturer Information :

Manufacturer Name : Nissan North America, Inc.

Address : P. O. BOX 685001

Franklin TN 37068-5009

Company phone : 800-647-7261

Population :

Number of potentially involved : 664,779

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2014-2016 Nissan Rogue

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : Based on production records, this issue is unique to these models and dates of manufacture listed above. Nissan Rogue vehicles manufactured after this date are unaffected because a change was made after MY 2016 at each of the plants to remove the harness tape. No other Nissan or INFINITI vehicles are affected because the harness layout and tape used are specific to the Nissan Rogue.

Production Dates : JUL 25, 2013 - SEP 28, 2016

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : In affected vehicles, if water and salt collect in the driver's side foot well, it may wick up the dash side harness tape and enter the connector.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the connector becomes corroded, electrical current may continue to flow between the connector terminals, potentially causing the driver's power seat or power window to become inoperative, AWD warning light illumination, battery discharge, and/or thermal damage to the connector. In the worst case condition, a fire can occur.

Description of the Cause : NR

Identification of Any Warning that can Occur : The customer may experience one or more of the following conditions: Driver's power window or power seat inoperative, AWD warning light illuminated, battery discharge, a burning odor, or smoke under the driver side dash.

Involved Components :

Component Name 1 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-4BA0A

Component Name 2 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-4BA0B

Component Name 3 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-4BA0C

Component Name 4 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-4BA0D

Component Name 5 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-4BA0E

Component Name 6 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-6FLOE

Component Name 7 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-6FLOB

Component Name 8 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-6FL1A

Component Name 9 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-6FL1B

Component Name 10 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24014-9TB6B

Component Name 11 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-6FL1C

Component Name 12 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-6FL1D

Component Name 13 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-6FL2B

Component Name 14 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-6FL2D

Component Name 15 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-7FA7A

Component Name 16 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-7FA7B

Component Name 17 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-7FA7C

Component Name 18 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24014-5HA1B

Component Name 19 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-7FA7C

Component Name 20 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-7FA7D

Component Name 21 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-7FA8D

Component Name 22 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TA0E

Component Name 23 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TA5E

Component Name 24 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TB0C

Component Name 25 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TB0D

Component Name 26 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TB0E

Component Name 27 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TB6A

Component Name 28 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TB6B

Component Name 29 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TB6C

Component Name 30 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TB6D

Component Name 31 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-9TB7E

Component Name 32 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-5HA0A

Component Name 33 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-5HA0C

Component Name 34 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-5HA1A

Component Name 35 : HARNESS-BODY
Component Description : Dash Side Harness
Component Part Number : 24017-5HA1B

Component Name 36 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HA1C

Component Name 37 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HA1D

Component Name 38 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HA2A

Component Name 39 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HA2B

Component Name 40 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HA3A

Component Name 41 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HJ0A

Component Name 42 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HJ0B

Component Name 43 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HJ0C

Component Name 44 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HJ0D

Component Name 45 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HJ1A

Component Name 46 : HARNESS-BODY

Component Description : Dash Side Harness

Component Part Number : 24017-5HJ1B

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

See attached Part 573 report for amended chronology.

Description of Remedy :

Description of Remedy Program : Owners of all MY2014-16 potentially affected vehicles received a final invitation to repair notification beginning on September 23, 2022. The letter instructed owners to bring their vehicle into a Nissan dealer for inspection, where the dealer will perform one of the following repairs:

- If corrosion is present on either of the connectors, the dealer will remove the harness tape and harness covering, replace both connectors and apply white lithium grease to the connectors.
- If corrosion is not present on either of the connectors, the dealer will remove the harness tape and harness covering and apply white lithium grease to the connectors.

Owners of the MY2017 vehicles which were erroneously included in the recall VIN file will receive an invitation to repair owner letter beginning on October 19, 2022. The letter will instruct owners to bring their vehicle into a Nissan dealer for inspection, where the dealer will inspect the vehicle to confirm that the production countermeasure has been applied.

Nissan will include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy since the subject vehicles are no longer under warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Dealers were notified beginning January 25, 2022. Owners of all potentially affected vehicles received an interim notification beginning on March 2, 2022 and ending on March 16, 2022. An updated dealer announcement was provided to dealers on August 26, 2022 informing them of the population change.

Owners of all MY2014-16 potentially affected vehicles received a final invitation to repair notification beginning on September 23, 2022.

Planned Dealer Notification Date : JAN 25, 2022 - AUG 26, 2022

Planned Owner Notification Date : SEP 23, 2022 - OCT 19, 2022

* NR - Not Reported