



REMEDY INSTRUCTIONS FOR WINNTEC MODEL 6020 LP REGULATOR

(NHTSA Recall Number: 22V067)

Dear Valued Dealer:

As you are aware, Holiday House, LLC d/b/a Holiday House RV (“Holiday House RV”) has decided that a defect which relates to motor vehicle safety exists in certain 2019-2021 18RB, 24TB, and 27RQ travel trailers.

Specifically, certain Winntec model 6020 LP regulators installed on these travel trailers may supply elevated, intermittent or low propane pressure to the appliances, which poses a safety issue to our customers.

These instructions provide a step-by-step guide on how to properly: (1) inspect each customer’s regulator to determine if the regulator is subject to this recall or not; and (2) if necessary, remove the affected regulator, replace it with a new regulator, and perform an industry standard LP system validation to ensure that the new regulator is functioning properly.

STEP 1: INSPECTING THE PROPANE REGULATOR

To determine whether a regulator is subject to this recall, please locate the “manufacturing date code” stamped into the Winntec Model 6020 LP regulator. This date code is a letter, followed by a space, followed by two numbers, followed by a space, followed by two numbers. **Any date codes where the first set of numbers is 17, 18, 19, 20, or 21, must be removed and replaced in accordance with this recall. Thus, you must remove and replace regulators with date codes N 17 XX, N 18 XX, N 19 XX, N 20 XX, or N 21 XX.** For example, if you were presented with the following regulator, then the regulator must be removed and replaced in accordance with this recall because the first set of numbers in the date code is 20:



Because the first set of numbers in this date code is 20, the regulator must be removed and replaced in accordance with this recall.

If the travel trailer does not have a Winntec Model 6020 LP regulator, or if the first set of numbers in the date code is not 17, 18, 19, 20, or 21, then you do not need to remove and replace the regulator.

STEP 2: REPLACING THE WINNTEC MODEL 6020 LP REGULATOR

If it is determined that the Winntec Model 6020 LP Regulator must be removed and replaced in accordance with this recall, you must perform the following:

- (1) Close the LP bottles and unscrew the pigtails from the LP bottles.
- (2) Remove the regulator from the unit.
- (3) Attach the new regulator to the unit.
- (4) Connect the pigtails to the LP bottles.
- (5) Check fittings, regulator, and connections using approved LP leak detection methods.
- (6) Perform a Drop Pressure Test by:
 - a. Inserting manometer into LP system.
 - b. Turning on both LP tanks.
 - c. Turning off both LP tanks.
 - d. Bleeding the system down to 8" water column.
 - e. To pass a Drop Pressure Test, the system must hold 8" water column for a minimum of 3 minutes.
- (7) Ensure system operating pressure is at 11" (+0.5") water column with 50% load, and lockout pressure does not exceed 14" water column.

Please note that vice grips, a universal screwdriver, and yellow gas line PTFE thread seal tape are required to perform this recall.

Please read the dealer notification letter dated March 16, 2022 which accompany these instructions. The dealer notification letter includes important information, including but not limited to, how to order a replacement regulator from Holiday House RV, and what documents you need to submit to Holiday House RV to be reimbursed for the reasonable labor costs incurred by you in performing this recall.

Please note that if you inspect a Holiday House RV travel trailer in accordance with these instructions, and the travel trailer is not subject to this recall, Holiday House RV will pay a flat rate of 0.1 hours to cover your labor costs.

If you must remove and replace a regulator in accordance with these instructions, then Holiday House RV will pay you a flat rate of 0.7 hours to cover your labor costs.

Sincerely,

Holiday House RV