

# Part 573 Safety Recall Report

# 22V-081

**Manufacturer Name :** Lamborghini (Automobili Lamborghini)

**Submission Date :** FEB 16, 2022

**NHTSA Recall No. :** 22V-081

**Manufacturer Recall No. :** L62X-R.01.22



## Manufacturer Information :

## Population :

**Manufacturer Name :** Lamborghini (Automobili Lamborghini)  
**Address :** Via Modena 12  
 Sant'Agata Bolognese (BO) 40019 -  
 Italy 00 99999  
**Company phone :** 999

**Number of potentially involved :** 4,796  
**Estimated percentage with defect :** 100 %

## Vehicle Information :

**Vehicle 1 :** 2015-2020 Automobili Lamborghini Huracan  
**Vehicle Type :** LIGHT VEHICLES  
**Body Style :** 2-DOOR  
**Power Train :** GAS

**Descriptive Information :** The recall population was determined based on the manufacturing records. The recalled vehicles do not fully comply with paragraph 49 CFR 571.108, Federal Motor Vehicle Safety Standard (FMVSS) No. 108 Lamps, Reflective Devices and Associated Equipment, point S10.18.9.2.

**Production Dates :** JUL 30, 2014 - MAY 14, 2020

**VIN Range 1 : Begin :** ZHWUC1ZF3FLA00517 **End :** ZHWUT5ZF2LLA15187  Not sequential

## Description of Noncompliance :

**Description of the Noncompliance :** The subject vehicles do not fully comply with paragraph 49 CFR 571.108, Federal Motor Vehicle Safety Standard (FMVSS) No. 108 Lamps, Reflective Devices and Associated Equipment.

The horizontal aim adjustment of the subject beams is possible due to the absence of a blanking cap over the beam horizontal adjustment screw. The customers can reach the horizontal adjustment screw and make the horizontal adjustment by themselves.

**FMVSS 1 :** 108 - Lamps, reflective devices, and assoc. Equipment

**FMVSS 2 :** NR

**Description of the Safety Risk :** Improper horizontal aim may result in glare to other motorists/road users, reduced visibility on one of the sides of the road, and reduced down-road visibility. Increasing the risk of a crash.

**Description of the Cause :** Due to a human error, the blanking cap over the lower beam horizontal adjustment screw had not been implemented on the subject vehicles.

Identification of Any Warning that can Occur : Not applicable.

## Involved Components :

Component Name 1 : Blanking cap

Component Description : Beam horizontal adjustment screw blanking cap

Component Part Number : 7PP941041

## Supplier Identification :

### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

## Chronology :

Lamborghini became aware of the potential situation when Research and Development department internal audit investigation identified missing blanking caps on internal vehicles. Further cross-department parts analysis revealed that the blanking caps were not being assembled in production.

On February 26th, 2020, the matter was presented to the product safety committee at Automobili Lamborghini S.p.A. and it was determined that the absence of a blanking cap over the beam horizontal adjustment screw represents a noncompliance with 49 CFR 571.108, Federal Motor Vehicle Safety Standard (FMVSS) No. 108 Lamps, Reflective Devices and Associated Equipment, point S10.18.9.2.

On March 04th 2020, Automobili Lamborghini submitted a 573 report notifying the agency about the non-compliance and informing about the intention of submitting a petition for Inconsequential Noncompliance.

On March 25th 2020, Automobili Lamborghini submitted the petition for Inconsequential Noncompliance.

On February 10th 2022, Automobili Lamborghini received NHTSA's Decision in consideration of the petition, which was denied.

Accordingly, Automobili Lamborghini will provide free remedy for the non-compliance.

## Description of Remedy :

Description of Remedy Program : Dealers will install the missing blanking caps free of charge. Customer are eligible for a refund of previously paid repairs. Lamborghini will verify the service history and proceed with the full reimbursement in case the defect is directly related to this recall content.

How Remedy Component Differs from Recalled Component : Introduction of a blanking cap.

Identify How/When Recall Condition was Corrected in Production : Huracan vehicles manufactured starting from CW15 of 2020 mount a blanking cap in respect of 49 CFR 571.108, Federal Motor Vehicle Safety Standard (FMVSS) No. 108 Lamps, Reflective Devices and Associated Equipment, point S10.18.9.2.

## Recall Schedule :

Description of Recall Schedule : Dealers/Owners: On or before April 15, 2022

Planned Dealer Notification Date : APR 08, 2022 - APR 08, 2022

Planned Owner Notification Date : APR 08, 2022 - APR 15, 2022

\* NR - Not Reported