



**Campaign code:**  
L62X-R.01.22

**Campaign Name:**  
Front headlight horizontal adjustment screw's blanking cap

**Model:**  
Huracán

**Model Year:**  
MY15, MY16, MY17, MY18, MY19, MY20

**Limited or special editions:**  
All

**Markets:**  
Canada, USA

**VIN Identification:**  
From ZHWUC1ZF3FLA00517 to ZHWUT5ZF2LLA15187


**Important information:** before proceeding with the repair, connect to the Warranty Portal and, using the "VIN Info" function, check that:

- the vehicle is actually affected by the instructions contained in this bulletin.

**NOTE:** some vehicles may not be affected, despite the fact that their Vehicle Identification Number (VIN) falls within the range;

- only replacement parts that correspond to the specific procedure, identified by a letter (such as A, B, C, etc.), are to be used for the chassis being repaired.

Example

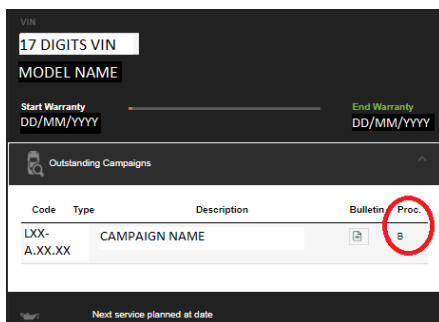

**N.B.:**

Procedure A will be available only when the instructions require a preliminary check to be performed to determine whether or not the vehicle actually needs updating.

**Information for the service network:**

Within the context of constant product monitoring, Automobili Lamborghini S.p.A. requires the application of two blanking caps on the front headlight horizontal adjustment screws, on USA/CANADA vehicles only. In fact, front headlight horizontal adjustment is not provided in these vehicles.

**Solution for the field:**

Application of blanking cap on front headlight horizontal adjustment screw.

**Spare Parts:**

**OPTION B**

Code	Description	Q
7PP941041	Blanking cap	2

**Management of replaced parts:**

Store the components that have been removed from the vehicle in an appropriate manner, marking them with their corresponding bar codes so that they can be identified during visits by the competent Area Manager.



**Labor time:**


Operation B: 0.3 hrs

**Previous bulletins superseded.**

None.

**Warranty claim instructions:**

To request reimbursement for the repair performed, access the "LIASS" system on the Lamborghini portal and, following the instructions in the system's "Manuals" section, generate and fill out a Warranty Request. Select the required campaign and proceed with entry; carefully read the options present in the alert message that displayed by the system (see example) and select the option performed on the vehicle.

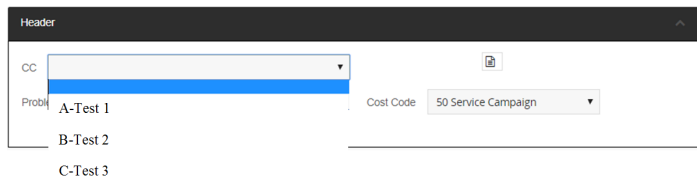

Reimbursement will be structured as follows, on the basis of the operation performed:

- **OPTION B:** Application of blanking cap on front headlight horizontal adjustment screw
  - o Labor: 0.3 hrs

**Important information:**

attach all documents generated during the work carried out, evidence of the work itself, for instance work orders and diagnostic protocols with BETA-Reports.

If one or more of these is missing, it may lead to a rejected reimbursement request.

Fill out the page in the warranty booklet (identified in the image below) in the section "Service and Recall Campaigns":

**Tools/Materials required**

Code	Description.	Qty.
n/a	n/a	n/a



**N.B. (\*)**

*All ODIS technical documentation can be viewed on the Lamborghini web portal, in the ODIS section.*



### Preliminary operations

#### 1. Removal of Luggage Compartment cover


Open the workshop manual to the desired Huracán vehicle and follow the path:

Chapter 08 → Body 63 → Interior covers and engine compartment → AN-Left Luggage Compartment Side Cover → Removal/Installation.

Chapter 08 → Body 63 → Interior covers and engine compartment → CA-Right Luggage Compartment Side Cover → Removal/Installation.

### Repair method


#### 2. Pinpoint the blanking cap installation position (on the right and left).

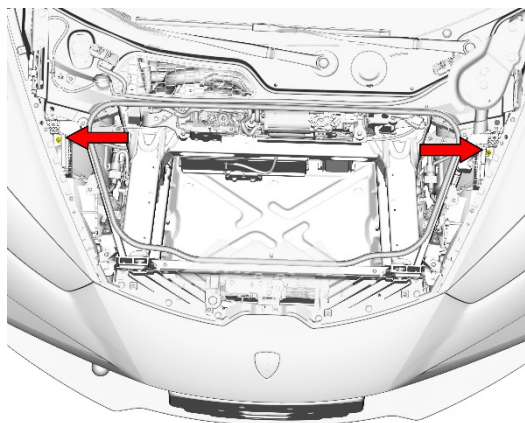

#### **WARNING**

Install the blanking caps on the headlights' front horizontal adjustment screws (green arrow, black screw).

Do not install the blanking caps on the vertical adjustment screws (yellow arrow, white screw).



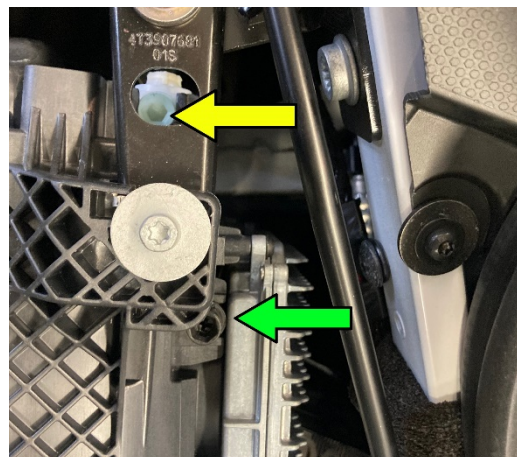


#### 3. Install the left-side blanking cap on the front-left hole by pressing as far as it goes.






4. Make sure the blanking cap (blue in the section A-A image) is fitted correctly and flush with the adjustment screw.

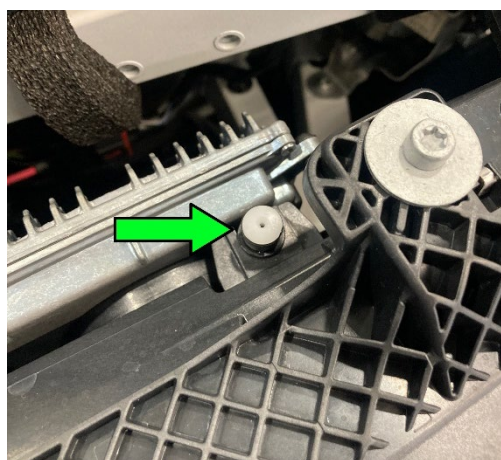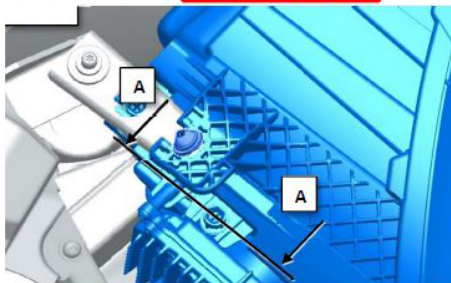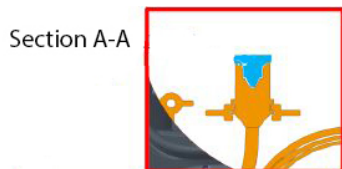

5. Repeat the operations in points 3 and 4 on the right side.

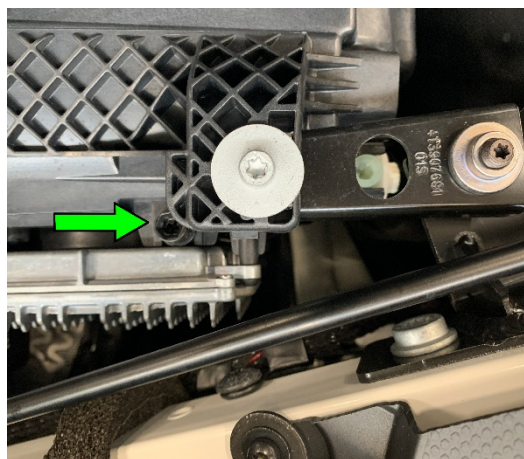

### Final operations

6. Re-installation of Luggage Compartment Cover

Re-install according to the instructions in the manual:

Chapter 08 → Body 63 → Interior covers and engine compartment → AN-Left Luggage Compartment Side Cover → Removal/Installation.

Chapter 08 → Body 63 → Interior covers and engine compartment → CA-Right Luggage Compartment Side Cover → Removal/Installation.



### **IMPORTANT:**

*The documents which must be provided together with the operation under warranty request are:*

- *Produced Repair Order*
- *Diagnostic protocol with BETA report saved*

*Failure to follow these procedures could lead to the request being rejected.*

For more information, please contact your Area Manager or write to Technical Support ([service.department@lamborghini.com](mailto:service.department@lamborghini.com)).