

Technical Service Bulletin

Technical Service Bulletin: TSB210271Released Date: 09-Dec-2021New Vibration Isolators for High Pressure Injector Supply Lines

New Vibration Isolators for High Pressure Injector Supply Lines

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- X12 CM2350 X119B
- X12 CM2450 X137B

Description of Change

- Vibration isolators have been added to the high pressure injector supply lines on the cylinder numbers 4, 5, and 6 **only**.
- The vibration isolators are supplied as part of a kit that also contains the high pressure injector supply line.
- Vibration isolators will be offered for sale individually, however, the high pressure injector supply lines will **only** be sold in the corresponding kit.


Reason for Change

The addition of vibration isolators will reduce the dynamic stress on the high pressure injector supply lines.

Service Instructions

- If existing high pressure injector supply line is replaced, use the new kit containing the line and the vibration isolator. See corresponding Service Manual. Reference Procedure 006-051 in Section 6.
 - New vibration isolator **must** be installed with a new high pressure injector supply line.
- If an existing vibration isolator has been lost or damaged, replace with a new vibration isolator. See corresponding Service Manual. Reference Procedure 006-051 in Section 6.
- The high pressure injector supply line and the vibration isolator are **not** assembled inside the kit. Verify the vibration isolators are installed. See corresponding Service Manual. Reference

Procedure 006-051 in Section 6.

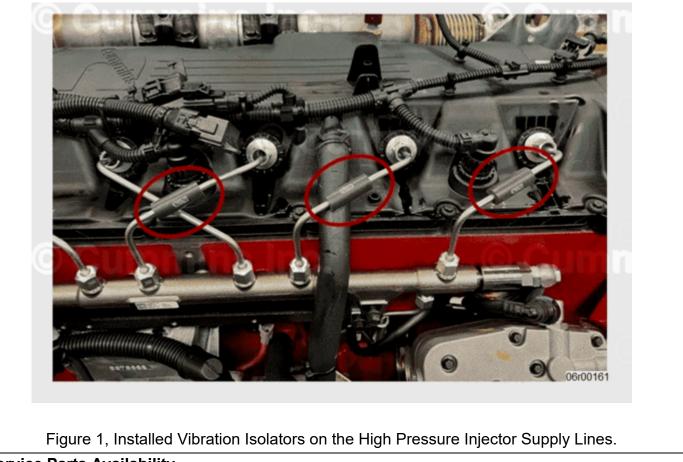

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts					
Part Description	Part Number Replaced	Part Number to Order			
High pressure Injector Supply Line	5536516	6303156			
Isolator	4390620	4390620			

Publications Affected

Table 2, Publications Affected					
Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section

Table 2, Public	Table 2, Publications Affected					
Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section	
Service Manual	X12 CM2350 X119B	5467515	Injector Supply Lines (High Pressure)	Refer to Procedure 006-051 (/qs3/pubsys 2/xml/en/proc edures/517/5 17-006- 051.html)	6	
Service Manual	X12 CM2350 X137B	5659705	Injector Supply Lines (High Pressure)	Refer to Procedure 006-051 (/qs3/pubsys 2/xml/en/proc edures/674/6 74-006- 051.html)	6	

Document History

Date	Details	
2021-12-9	Module Created	

Last Modified: 09-Dec-2021