TECHNICAL INSTRUCTIONS

FOR

SAFETY RECALL 22TA02

PRE-COLLISION SYSTEM (PCS) INOPERATIVE WITHOUT WARNING INDICATOR

CERTAIN 2021 MODEL YEAR C-HR

IX. OPERATION FLOW CHART



X. IDENTIFICATION OF AFFECTED VEHICLES

1. CHECK VEHICLE FOR CAMPAIGN ELIGIBILITY

- a) Compare the vehicles VIN to the VIN listed on the Repair Order to ensure they match.
- b) Check the TIS Vehicle Inquiry System to confirm the VIN is involved in this Campaign, and that it has not already been completed.

HINT:

TMNA warranty will not reimburse dealers for repairs completed on vehicles that are not affected or were previously completed, even by another dealer.

XI. PREPARATION

A. TOOLS & EQUIPMENT

- Techstream
- Tire pressure gauge
- LevelTape measure
- Weight with pointed tip (plumb bob)
- Laser line marker

SPECIAL SERVICE TOOLS

Part Number	Part Name	Quantity	Remarks	
09870-60000*	Laser Radar Adjusting Reflector (Kit)*	1	For TRIANGLE TARGET	
09870-60100	Flat Target	1		
09870-60110	Panel Stand	1	FOR FLAT SURFACE TARGET	

*Essential SST

B. MATERIALS

• String

Tape

XII. BACKGROUND



NOTE: Adjustment with triangle target (Laser Radar Adjusting Reflector; Part Number 09870-60000) shown as a representative example.

XIII. PRE-PREPARATION FOR TSS CHECK TOOL

1. PURPOSE OF THIS APPLICATION

a) The TSS Check Tool is an application that checks the adjustment status of the millimeter wave radar beam axis.

2. PC HARDWARE/SOFTWARE REQUIREMENTS

a) Techstream 2.0 / Techstream ADVI / Techstream Lite with software version 16.3 or greater installed.

3. AFFECTED VEHICLE

a) TSS Check Tool is a limited application only for vehicles covered by Safety Recall 22TA02. Do not use for other vehicles.

4. DOWNLOAD TSS CHECK TOOL

HINT:

Once downloaded, no download is required from the next time onwards.

- a) <u>Click here</u> to download TSS Check Tool.
- b) Open the downloaded ZIP file or extract the contents and confirm that the TSS Check Tool folder was created.

XIV. INSPECT MILLIMETER WAVE RADAR SENSOR ASSEMBLY

HINT:

The target is not required to be installed when inspecting with TSS Check Tool.



1. CHECK FOR DTC'S

a) Using a Techstream, perform a Health Check to check for Diagnostic Trouble Codes.

HINT:

This campaign covers only the inspection and adjustment of the millimeter wave radar sensor assembly. It does not cover the diagnosis or replacement of any other parts on the vehicle.

名前	更新日
CSDFCommControler.dll	2021/0
SDFCommonDLL.dll	2021/0
CSDFCommunicationLog.dll	2021/0
CSDFMessageControlerFactory.dll	2021/0
CSDFWindowTemplate.dll	2021/0
TSSCheckTool.exe	2021/1
SSCommunication.dll	2021/1
	S211200193033aS

2. INSPECT MILLIMETER WAVE RADAR SENSOR ASSEMBLY

a) Exit Techstream. If any software that uses VIM other than Techstream is running, exit all.

NOTICE:

If the inspection is performed without exiting, the inspection result may result in ERROR.

- b) With PC and VIM (Techstream/Mongoose cable) connected to the vehicle and in IG ON, double-click "TSSCheckTool.exe" in TSS Check Tool folder to start.
- c) Click the Next button.



TSS Check Tool	
Now reading	
	S211200193035aS

d) Wait for communication to finish.

1	"OK" IS Shown as a repi ISS Check Tool	resentative.
	Result	
	OK	
	No Need Reme	dy
	VIN/Frame No.: *************** Date: 07/Dec/2021	
		Exit

- e) When communication with the vehicle is completed, the inspection result is automatically displayed.
- f) Confirm the correspondence in the following table based on the display results.

HINT:

- The illustration shows "OK" as a representative.
- VINs acquired by communication are displayed in VIN/Frame No. If VIN could not be obtained, it will be blank.
- Date shows the date of the computer.

Judgment	Screen display	Adjustment required/not required	Correspondence/reference destination
OK	No Need Remedy VIN/Frame No: ***********************************	Not required	Work completed
NG	Result No Good Need Action Please Check TI VIN/Frans No: ***********************************	Required	 Take a picture or screenshot of the result, which is required for the warranty claim, then adjust the millimeter wave radar sensor using one of the following procedures: TARGET ADJUSTMENT (TRIANGLE TARGET) (Go to page 7.) TARGET ADJUSTMENT (FLAT SURFACE TARGET) (Go to page 8.)
ERROR	TEOLeck Ind Result ERROR(02) Need Action Please Check TI VIN/Frame No.: Date: 08/Dec/2021 Exit S211200193038as	-	Refer to Appendix B on page 12 to define error identification numbers. Once the error is resolved, re-execute the TSS Check Tool.

g) Click Exit to exit TSS Check Tool.

XV.TARGET ADJUSTMENT (TRIANGLE TARGET)

NOTICE: Target Adjustment is only needed if the result of TSS Check Tool was "NG". If the result of TSS Check Tool was "NG", follow the instructions in the link below to perform target adjustment.

1. <u>Refer to TIS for instructions on Engine / Hybrid System / CRUISE CONTROL / MILLIMETER WAVE</u> <u>RADAR SENSOR / TARGET ADJUSTMENT (TRIANGLE TARGET)</u> (RM100000010F01)

HINT:

If Error No. 1 or No. 8 is stored and the adjustment of the millimeter wave radar axis is not finished after the radiator grille emblem surface is cleaned, clean Millimeter Wave Radar Sensor Assembly (surface of the sensor body).



HINT:

Install the SST (reflector) by aligning the scribe line of the SST (reflector) with point C as shown in the illustration.

- 2. RECONFIRMATION BY TSS CHECK TOOL AFTER COMPLETING TARGET ADJUSTMENT
- a) Exit Techstream. If any software that uses VIM other than Techstream is running, exit all.

NOTICE:

If the inspection is performed without exiting, the inspection result may result in ERROR.

b) Turn the IG off (no waiting time required) and IG ON again. **NOTICE:**

Turn the IG off because the content of adjustment is not stored in the millimeter wave radar sensor ASSY unless the IG is turned off. TSS Check Tool is to be executed with the above content stored, otherwise false positives may result.





- c) Execute "TSSCheckTool.exe" again and confirm that the inspection result is "OK".
 NOTICE:
 If "NG" is displayed on the inspection result, perform the millimeter wave radar axis adjustment again. If "NG" is displayed even after three retries, the ECU may be damaged. Check the relevant ECU by health check, etc.
- d) Turn the IG off.
- e) Remove Techstream from DLC3.

XVI. TARGET ADJUSTMENT (FLAT SURFACE TARGET)

NOTICE: Target Adjustment is only needed if the result of TSS Check Tool was "NG". If the result of TSS Check Tool was "NG", follow the instructions in the link below to perform target adjustment.

1. <u>Refer to TIS for instructions on Engine / Hybrid System / CRUISE CONTROL / MILLIMETER WAVE</u> <u>RADAR SENSOR / TARGET ADJUSTMENT (FLAT SURFACE TARGET)</u> (RM10000001QFQ2)

HINT:

If Error No. 1 or No. 8 is stored and the adjustment of the millimeter wave radar axis is not finished after the radiator grille emblem surface is cleaned, clean Millimeter Wave Radar Sensor Assembly (surface of the sensor body).

- 2. RECONFIRMATION BY TSS CHECK TOOL AFTER COMPLETING TARGET ADJUSTMENT
- a) Exit Techstream. If any software that uses VIM other than Techstream is running, exit all.

NOTICE:

If the inspection is performed without exiting, the inspection result may result in ERROR.

b) Turn the IG off (no waiting time required) and IG ON again. **NOTICE:**

Turn the IG off because the content of adjustment is not stored in the millimeter wave radar sensor ASSY unless the IG is turned off. TSS Check Tool is to be executed with the above content stored, otherwise false positives may result.





c) Execute "TSSCheckTool.exe" again and confirm that the inspection result is "OK".
 NOTICE:

If "NG" is displayed on the inspection result, perform the millimeter wave radar axis adjustment again. If "NG" is displayed even after three retries, the ECU may be damaged. Check the relevant ECU by health check, etc.

- d) Turn the IG off.
- e) Remove Techstream from DLC3.

XVII. WORK COMPLETION

1. PRINT CUSTOMER HEALTH CHECK REPORT

a) From the Stored Data tab, select the Customer Health Check Report button (TIS will launch when button is pressed).



- b) Log in to TIS.
- c) Input Vehicle Mileage and Repair Order number.
- d) Check the "Performed" campaign radio button for the applicable campaigns completed during this service event.
- e) Select the Report button.

	\odot	Diagnostic Report	
		Mileage: 7787 Repair Order: 7788	
		Dur systems show the following campaigns are outstanding. Have iny of these campaigns been completed? (Check for SSC door label if insure.) XXX: C. Deformed Report	
f) Confirm Customer	Health Check	Report information is correct.	

9



Diagnostic Report

Vehicle Information

Vehicle: XXXXXXXXXXX Repair Order: 12345 VIN: XXXXXXXXXXXXXXXXXXXXXX

Mileage: 13672

Health Check Summary

Checkpoints	Status	Comments
Powertrain	All systems OK	
Chassis	All systems OK	
Electrical	All systems OK	
Network Systems	All systems OK	
Service Campaigns	No Action Required	XXX Performed
		Performed: XX/XX/XX, X:XX XX (PST)

Technician Signature

Quality Inspector Signature

g) Print Customer Health Check Report from TIS.

h) Sign and provide to the customer.

◄ VERIFY REPAIR QUALITY ►

- Confirm that the millimeter wave radar sensor has been properly initialized, if necessary.
- If you have any questions regarding this recall, please contact your regional representative.

XVIII. APPENDIX

A. CAMPAIGN DESIGNATION DECODER



B. WHEN ERROR IS DISPLAYED



Refer to the following table while referencing the error identification number shown in the error result to determine and eliminate the cause of the error.

Error identification number	Error Overview	Possible cause	Correspondence
01	Other software is	Software using VIM such as	Exit the software using VIM.
02	VIM connect failed	 The PC and VIM are not connected. The VIM selected in Techstream does not match the VIM that is actually connected. 	 Checking the VIM connection status. Check the VIM setting of Techstream.
03	ECU response error	The vehicle is not in IG ON status.	Turn the IG ON.
04			
05			
06	Unaffected vehicle	The connected vehicle is not the	
07		model applicable to TSS Check Tool.	-
08			
09			