



GROUP	MODEL
Safety Recall Campaign	2022MY Sorento P/HEV (MQ4 P/HEV)
NUMBER	DATE
SC231	April 2022

SAFETY RECALL CAMPAIGN

FRONT SEAT BELT PRETENSIONER REPLACEMENT (SC231)

SUBJECT:

This bulletin provides information to replace front seat pretensioner(s) on certain 2022MY Sorento P/HEV (MQ4 HEV) produced from July 17, 2021 through July 2, 2022 and certain 2022MY Sorento P/HEV (MQ4 HEV) vehicles produced from July 2, 2022 through July 16, 2022. The front driver-side and/or front passenger-side belt pretensioner(s) in the affected vehicles were manufactured from a suspect production run of pyrotechnic-type pretensioners that may deploy prematurely during a crash, which could cause metal fragments to injure the vehicle occupant compartment. Follow the procedure outlined in this publication to replace the seat belt pretensioner(s). Before conducting the procedure, verify that the vehicle is included in the list of affected vehicles. Vehicles will be identified in WebDCS as SC231B.

Campaign Number	Front Seat Belt Pretensioner(s) to Replace
SC231B	Driver Side Only
SC231B	Passenger Side Only
SC231B	Both Driver and Passenger (LH & RH) Sides



NOTICE

There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.

NOTICE

To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service → Warranty Coverage → Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.

Replacement Procedure:

ⓘ IMPORTANT

BEFORE replacing the seat belt pretensioner assembly, look up the vehicle in the "Vehicle Information" screen on WebDCS, then go to the "Campaign Not Performed" section. Look in the 'Campaign Description' field to determine which parts are to be replaced for each vehicle:


- RH = Right hand (passenger) side ONLY
- LH = Left hand (driver) side ONLY
- RH/LH = Both sides

Removed seat belt pretensioner(s) CANNOT be reused. The removed part must be taped up and sealed in the original box at the dealer for 30 days after claim payment. If parts are not retained for the specified period, the claim may be subject to chargeback. Refer to Warranty Bulletin 2022-13 for further instructions. **This bulletin will be revised shortly with further part return instructions.**

1. Replace the applicable front seat belt pretensioner assembly (A) (see "Important note above") by referring to the "Body (Interior and Exterior) → Front Seat Belt → Front Seat Belt Pretensioner → Repair procedures" chapter in the applicable Shop Manual on KGIS.

📄 NOTICE

Use a non-marring trim removal tool (such as Snap-on® Part Number PBN5 or equivalent) to avoid damaging trim pieces.

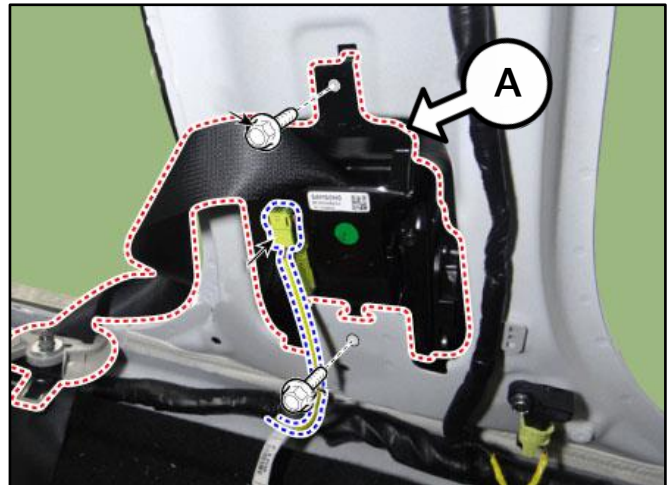


Tightening torque for bolt(s):
28.9 - 39.7 lb.ft (39.2 - 53.9 N.m)

SUBJECT:

FRONT SEAT BELT PRETENSIONER REPLACEMENT (SC231)**AFFECTED VEHICLE RANGE:**

Model	Production Date Range
Sorento HEV (MQ4 HEV)	July 12, 2021 to July, 28, 2021
Sorento PHEV (MQ4 PHEV)	July 14, 2021 to July 16, 2021

REQUIRED PART:

Part Name	Location	Part Number*	Figure	Qty.
Seat Belt Pretensioner Assembly	Driver Left Side	88810 P4500WA6QK		1
		88810 P4500WKQK		
	Passenger Right Side	88820 P4500GYTQK		1
		88820 P4500WA6QK		
		88820 P4500WKQK		

***Note:** BEFORE ordering, refer to "Important" note in Replacement Procedure to ensure correct parts for the vehicle are being ordered.

WARRANTY INFORMATION:**N Code: N99 C Code: C99**

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
R	898P0 S1000	0	(SC231L) Front Seat Belt Pretensioner Replacement (Driver [Left] side only)	221042R0	0.4 M/H	88810 P4500WA6QK or 88810 P4500WKQK	1
	898R0 S1000	0	(SC231R) Front Seat Belt Pretensioner Replacement (Passenger [Right] side only)	221042R1	0.4 M/H	88820 P4500GYTQK or 88820 P4500WA6QK or 88820 P4500WKQK	1
	898P0 S1000	0	(SC231B) Front Seat Belt Pretensioner Replacement (Both Driver & Passenger [Left & Right] sides)	221042R2	0.6 M/H	88810 P4500WA6QK or 88810 P4500WKQK or 88820 P4500GYTQK or 88820 P4500WA6QK or 88820 P4500WKQK	1

When necessary, manually enter sublet code 'X2' for reimbursement of one roundtrip rideshare expense or up to three (3) days of rental for parts replacement. Attach supporting documentation.

Refer to Warranty Bulletin 2022-13 for claim submission procedures.

NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference **SC231** when accessing the WebDCS system.

