


## RECALL 22V185, 2022-139 REMEDY INSTRUCTIONS

	Make(s): SURVEYOR Model(s): SVT19MDBLE Model Year(s): 2022	Repair Code: RC-024-01-00-004174 Allotted Time: .50 HRS. Inspection Code: RC-024-05-00-004173 Allotted Time: .10 HRS.
	Concern: The fresh air intake tube length was not lengthened when the furnace was moved.	Photo(s) Required: YES Prior Authorization Required: YES Part(s) Kit Number: 052162 Part(s) Return: NO

**Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.**

STEP 1: LOCATE THE FURNACE FLUE ON THE EXTERIOR OF THE VEHICLE;

STEP 2: REMOVE SIX SCREWS FROM THE FURNACE FLUE EXTERIOR (FIGURE 1);

STEP 3: USING A UTILITY KNIFE TO CUT THE SEAL AROUND THE VENT (FIGURE 1);

STEP 4: USE A 5 IN 1 PAINTERS MULTI TOOL OR A STIFF SCRAPER TO PUSH IN BEHIND THE VENT TO BREAK LOOSE THE BUTYL TAPE ALL THE WAY AROUND THE VENT;

STEP 5: TAKE CARE TO NOT DAMAGE STRIPES OR CAUSE BODY WORK, PUSH THE MULTI TOOL/SCRAPER REMOVE THEN PUSH IT IN AGAIN IN THE NEXT SPOT UNTIL BUTYL TAP IS BROKEN FREE ALL THE WAY AROUND THE VENT;

STEP 6: TAKE THE MULTI TOOK PUSH IT IN BEHIND THE VENT AND PRY OUT ON BOTH SIDES UNTIL THE VENT IS AWAY FROM THE WALL;

STEP 7: USING YOUR HANDS PULL OUT THE VENT WHILE USING A TWISTING MOTION AS THE EXHAUST FITS EXTREMELY TIGHT. DO NOT FORCE THE VENT, IT WILL COME OUT SLOWLY;

STEP 8: CLEAN CAULK AND BUTYL FROM VENT AND WALL;

STEP 9: REPLACE BUTYL ALL THE WAY AROUND THE VENT SO THERE ARE NO GAPS MAKING SURE ALL THE SCREW HOLES ARE COVERED;

STEP 10: REPLACE THE INTAKE TUBE WITH THE LONGER 052162 INTAKE TUBE;

STEP 11: PUSH THE VENT BACK ON THE FURNACE MAKING SURE INTAKE AND EXHAUST TUBES ARE ALIGNED CORRECTLY WITH THE FURNACE;

STEP 12: PUT THE SIX SCREWS BACK IN AND SEAL AROUND THE VENT MAKING SURE THERE ARE NO SEAL VOIDS;

STEP 13: CLAIM REPAIR CODE.

# RECALL 22V185, 2022-139 REMEDY INSTRUCTIONS



Make(s): SURVEYOR  
Model(s): SVT19MDBLE  
Model Year(s): 2022

Concern:  
The fresh air intake tube length was not lengthened when the furnace was moved.

Repair Code: RC-024-01-00-004174  
Allotted Time: .50 HRS.  
Inspection Code: RC-024-05-00-004173  
Allotted Time: .10 HRS.

Photo(s) Required: YES  
Prior Authorization Required: YES  
Part(s) Kit Number: 052162  
Part(s) Return: NO

FIGURE 1:

