

Part 573 Safety Recall Report

22V-200

Manufacturer Name : Lance Camper Manufacturing, Corp.**Submission Date :** APR 07, 2022**NHTSA Recall No. :** 22V-200**Manufacturer Recall No. :** NR**Manufacturer Information :****Population :****Manufacturer Name :** Lance Camper Manufacturing, Corp.**Number of potentially involved :** 77**Address :** 43120 Venture Street**Estimated percentage with defect :** 100 %

Lancaster CA 93535

Company phone : 661-949-3322**Vehicle Information :****Vehicle 1 :** 2022-2022 lance 650, 825, 865, 1062, 1172**Vehicle Type :** TRAILERS**Body Style :****Power Train :** NR

Descriptive Information : Identified in production, First new 2022 product with new water heater was installed 10/05/2021-
conducted a rework on the line to install per manufactures specification. 77

Production Dates : OCT 05, 2021 - FEB 26, 2022**VIN Range 1 : Begin :** 178378000000000000 **End :** 178783000000000000 ☒ **Not sequential****Description of Defect :**

Description of the Defect : Truma water heater, Data cable is routed through the cold water inlet located at the rear of the water heater and could rest on the burner box

FMVSS 1 : NR**FMVSS 2 :** NR**Description of the Safety Risk :** Data cable could short and possibly catch fire**Description of the Cause :** Data cable melted from burner box.

Identification of Any Warning that can Occur : water heater control panel and water heater does not operate

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

During the manufacturing process on the new 2022 model Campers it was noted the Data cable was being installed through the incorrect routing. Management, Stopped production and corrected the incorrect routing of the cable.

Description of Remedy :

Description of Remedy Program : Reroute the Data cable from the cold water inlet to the correct inlet on the side of the water heater with the supplied bushing grommet and zip tie, Dealer will be reimbursed for labor through a warranty claim.

NOTE: Customers who have had this remedy completed before this recall are eligible for reimbursement, contact Lance customer service (661) 949-3322

How Remedy Component Differs from Recalled Component : both components are the same, the Noncompliance was caused for not following the manufacturer's installation instructions.

Identify How/When Recall Condition was Corrected in Production : routed the data cable per the manufactures instructions. recall was corrected on the line 02/26/2022

Recall Schedule :

Description of Recall Schedule : Mail out dealer and owner letters

Planned Dealer Notification Date : MAY 27, 2022 - JUN 30, 2022

Planned Owner Notification Date : MAY 27, 2022 - JUN 30, 2022

* NR - Not Reported