

Part 573 Safety Recall Report

22V-201

Manufacturer Name : Lance Camper Manufacturing, Corp.**Submission Date :** MAY 13, 2022**NHTSA Recall No. :** 22V-201**Manufacturer Recall No. :** NR**Manufacturer Information :****Population :****Manufacturer Name :** Lance Camper Manufacturing, Corp.**Number of potentially involved :** 18**Address :** 43120 Venture Street**Estimated percentage with defect :** 100 %

Lancaster CA 93535

Company phone : 661-949-3322**Vehicle Information :****Vehicle 1 :** 2022-2022 Lance 1685, 1985, 1995, 2185, 2445**Vehicle Type :** TRAILERS**Body Style :****Power Train :** NR

Descriptive Information : discovered on the line on new 2022 units with the Truma water heater option.
all units built within the dates are effected
18 units effected

Production Dates : OCT 05, 2021 - FEB 26, 2022**VIN Range 1 : Begin :** 56YTT2420NL332523 **End :** 56YTT2127NL333141 ☒ **Not sequential****Description of Defect :**

Description of the Defect : Truma water heater, DATA CABLE IS ROUTED THROUGH THE COLD WATER INLET IN THE REAR OF THE WATER HEATER AND COULD REST AGAINST BURNER BOX

FMVSS 1 : NR**FMVSS 2 :** NR**Description of the Safety Risk :** DATA CABLE SHORT POSSIBLE FIRE**Description of the Cause :** DATA CABLE MELTED FROM BURNER BOX

Identification of Any Warning that can Occur : WATER HEATER CONTROL PANEL AND WATER HEATER INOPERERTIBLE.

Involved Components :

Component Name 1 : Gas connector elbow kit

Component Description : kit includes hole plug, rubber insulator, zip tie and elbow if needed

Component Part Number : 77000-37500

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

During the manufacturing process on 02/26/2022 on the new 2022 model Campers it was noted the Data cable was being installed through the incorrect routing. Management, Stopped production We investigated and corrected the incorrect routing of the cable on the unshipped units and the production line was corrected. after the investigation was complete we researched the affected units by serial number and submitted for approval from corporate, corporate approved 03/25/22

Description of Remedy :

Description of Remedy Program : REROUTE THE DATA CABLE FROM THE COLD WATER INLET AND REROUTE PER MANUFACTURER SPECIFACATIONS.
LANCE WILL REIMBURSE DEALER THROUGH A WARRANTY CLAIM.

NOTE:Customers who have had this remedy completed before this recall are eligible for reimbursement, contact Lance customer service (661) 949-3322

How Remedy Component Differs from Recalled Component : INSTALLATION ERROR.

Identify How/When Recall Condition was Corrected in Production : ROUTED THE DATA CABLE PER THE MANUFACTURER SPECIFICATIONS

Recall Schedule :

Description of Recall Schedule : MAIL OUT DEALER AND CUSTOMER LETTERS

Planned Dealer Notification Date : MAY 27, 2022 - JUN 30, 2022

Planned Owner Notification Date : MAY 27, 2022 - JUN 30, 2022

* NR - Not Reported