

# Part 573 Safety Recall Report

## 22V-209

**Manufacturer Name :** Keystone RV Company

**Submission Date :** MAR 31, 2022

**NHTSA Recall No. :** 22V-209

**Manufacturer Recall No. :** 22-430



### Manufacturer Information :

Manufacturer Name : Keystone RV Company

Address : PO Box 2000  
2642 Hackberry Drive Goshen IN  
46527

Company phone : 574-535-2100

### Population :

Number of potentially involved : 513

Estimated percentage with defect : 100 %

### Vehicle Information :

Vehicle 1 : 2019-2022 Keystone Cougar 29FKD

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : 29FKD floor plan

Production Dates : MAR 22, 2019 - FEB 01, 2022

VIN Range 1 : Begin : 4YDT29F26KV510568 End : 4YDT29F26KV510568 ☒ Not sequential

VIN Range 2 : Begin : 4YDT29F21LV501245 End : 4YDT29F2XLV509098 ☒ Not sequential

VIN Range 3 : Begin : 4YDT29F20MV501156 End : 4YDT29F27MV512901 ☒ Not sequential

VIN Range 4 : Begin : 4YDTCGP20NV500784 End : 4YDTCGP24NV505003 ☒ Not sequential

### Description of Defect :

Description of the Defect : It has been decided that on certain Cougar 29FKD Travel Trailers, the tires may come in contact with an outrigger.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Under certain conditions during travel, if the tires make contact with the outrigger causing a tire blow out, it can lead to an increased risk of personal injury or vehicle crash.

Description of the Cause : The outrigger was installed incorrectly allowing the tire to come into contact under certain conditions over time.

Identification of Any Warning that can Occur : Visible tire damage.

### Involved Components :

Component Name 1 : 29FKD Frame

Component Description : Frame - CGHT29FKD - TT - 2019 - 8" JR I Beam - 1 G4 Slide - 1 Ram Slide - w/  
Accessory Receiver - w/3.0

Component Part Number : 630175

### Supplier Identification :

#### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

### Chronology :

3/14/2022 – A claim was received that a Cougar 29 FKD had a tire that was damaged due to hitting an outrigger. A claim review was initiated that yielded 2 similar claims that had been misdiagnosed as suspension issues. Investigation into scope and range opened.

3/29/2022 – Investigation concluded and scope and range completed.

### Description of Remedy :

Description of Remedy Program : The remedy will be to notch the existing outrigger to provide clearance for the tire and an additional outrigger will be added between the two tires over the center spring hanger. Manufacturer Reimbursement Plan on file as of 10/07/2020. General reimbursement plan to be updated every two years. New vehicles are covered under warranty.

How Remedy Component Differs from Recalled Component : The existing outrigger will be notched out to provide clearance for the tire and an additional outrigger will be added between the two tires over the center spring hanger.

Identify How/When Recall Condition was Corrected in Production : Units in the range were older builds and shipped prior to the decision to recall.

### Recall Schedule :

Description of Recall Schedule : Keystone will notify the dealers and owners of the recreational vehicles

Planned Dealer Notification Date : MAY 23, 2022 - MAY 23, 2022

Planned Owner Notification Date : MAY 23, 2022 - MAY 23, 2022

by letter. A final copy of the owner letter will be provided to NHTSA, along with the dealer repair procedures.

\* NR - Not Reported