

# Part 573 Safety Recall Report

## 22V-216

**Manufacturer Name :** Autocar, LLC

**Submission Date :** APR 01, 2022

**NHTSA Recall No. :** 22V-216

**Manufacturer Recall No. :** ACX-2201



### Manufacturer Information :

**Manufacturer Name :** Autocar, LLC

**Address :** 551 S WASHINGTON STREET  
HAGERSTOWN IN 47346

**Company phone :** 7654895499

### Population :

**Number of potentially involved :** 535

**Estimated percentage with defect :** 100 %

### Vehicle Information :

**Vehicle 1 :** 2021-2022 Autocar Xpeditor (ACX)

**Vehicle Type :** BUSES, MEDIUM & HEAVY VEHICLES

**Body Style :** OTHER

**Power Train :** NR

**Descriptive Information :** All Xpeditor (ACX) units equipped with the suspect wiring harness are included.

**Production Dates :** AUG 07, 2020 - NOV 05, 2021

**VIN Range 1 :** Begin : 5VCACLCE2MC234054 End : 5VCACLAF4NC238717  Not sequential

### Description of Defect :

**Description of the Defect :** The ABS modulation valve wiring may be incorrect.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** If the ABS modulation valve circuits are incorrect the potential increase in stopping distance would increase the risk of property damage, personal injury or a crash.

**Description of the Cause :** Autocar design error resulted in the incorrect wiring harness pinning.

**Identification of Any Warning that can Occur :** None.

### Involved Components :

Component Name 1 : Autocar ABS Harness

Component Description : ABS Harness

Component Part Number : A7471066-002

## Supplier Identification :

### Component Manufacturer

Name : Autocar LLC

Address : 551 S Washington St  
Hagerstown Indiana 47346

Country : United States

## Chronology :

March 3, 2022 During an internal validation test Autocar identified an air leak during testing and began researching to determine root cause. The root cause determined to be a design error regarding the pinning of the harness at pin 3 and pin 6 on harness A7471066-002 and a clean point established for production units. March 25, 2022 All data gathered and presented to Autocar management team and Autocar decided to perform a voluntary safety recall. Note: There are no claims, complaints or known failures, This was discovered internally during production validation.

## Description of Remedy :

Description of Remedy Program : The ABS wiring harness will be repaired or replaced at no charge to the owner.

How Remedy Component Differs from Recalled Component : The ABS wiring harness will be repaired or replaced.

Identify How/When Recall Condition was Corrected in Production : March 11, 2022 All production units were contained and re-work completed prior to release.

## Recall Schedule :

Description of Recall Schedule : Dealer and Customer notifications will begin May 30, 2022 and end May 31, 2022

Planned Dealer Notification Date : MAY 30, 2022 - MAY 31, 2022

Planned Owner Notification Date : MAY 30, 2022 - MAY 31, 2022

\* NR - Not Reported