

Part 573 Safety Recall Report

22V-292

Manufacturer Name : DRV Suites**Submission Date :** MAY 05, 2022**NHTSA Recall No. :** 22V-292**Manufacturer Recall No. :** TBD**Manufacturer Information :****Manufacturer Name :** DRV Suites**Address :** 1000 Interchange Drive
PO Box 235 Howe IN 46746**Company phone :** 574-457-6472**Population :****Number of potentially involved :** 88**Estimated percentage with defect :** 100 %**Vehicle Information :****Vehicle 1 :** 2022-2022 DRV Mobile Suites**Vehicle Type :** TRAILERS**Body Style :** OTHER**Power Train :** NR**Descriptive Information :** The population was determined by cross-referencing out Production PO numbers with affected Flex-Tech shipments**Production Dates :** JUL 27, 2021 - DEC 16, 2021**VIN Range 1 : Begin :** 5KEAG4323N1479876 **End :** 5KEAG432XN1496139 ☒ Not sequential**Vehicle 2 :** 2022-2022 DRV Full House**Vehicle Type :** TRAILERS**Body Style :** OTHER**Power Train :** NR**Descriptive Information :** The population was determined by cross-referencing out Production PO numbers with affected Flex-Tech shipments**Production Dates :** SEP 29, 2021 - DEC 15, 2021**VIN Range 1 : Begin :** 5KEAG4630N1486885 **End :** 5KEAG4632N1496138 ☒ Not sequential**Description of Defect :****Description of the Defect :** Flex-Tech has informed us that the brass used in production may be porous causing small cracks in the LP Quick disconnect. Therefore the Quick disconnect/s in the LP gas system may be cracked.**FMVSS 1 :** NR

FMVSS 2 : NR

Description of the Safety Risk : A Crack in the LP disconnect can cause an LP leak. Excessive LP gas leak may lead to an explosion and fire, which may lead to property damage and personal injury.

Description of the Cause : Porous brass from the manufacturer can lead to cracks in the fitting when tightening during assembly.

Identification of Any Warning that can Occur : The owner may notice the smell of LP gas near the quick disconnect mounted under the trailer.

Involved Components :

Component Name 1 : LP quick disconnect

Component Description : LP quick disconnect female

Component Part Number : 76290W

Supplier Identification :

Component Manufacturer

Name : Enerco Group Inc

Address : 4560 West 160 St.
Cleveland Ohio 44135

Country : United States

Chronology :

4/6/22 was notified by Thor Corp of Forest Rivers findings of faulty disconnects. 4/7 to 4/20 FRC and Warranty claims investigation and analysis. 4/19 Received shipment and PO information from Flex Tech. 4/20 - found "0" warranty claims with no property damage or personal injuries. 4/20 received letter from Flex-Tech stating LP disconnect issue with Flex-Techs findings. 4/26 safety committee meeting voted for voluntary recall. Investigation called for to determine the affected unit scope and range.

Description of Remedy :

Description of Remedy Program : DRV will have an authorized dealer or repair center inspect the quick disconnect. If found faulty, the dealer will replace the LP quick connect and perform a drop pressure test to verify proper installation. This repair should take no more than 25 minutes to complete. This defect will be corrected at no expense to you, the owner. All Reimbursements will be covered by DRV's general reimbursement plan.

How Remedy Component Differs from Recalled Component : 76290W Quick Disconnect replacement will have the same part number 76290W

Identify How/When Recall Condition was Corrected in Production : On March 31, 2022 the supplier indicated that they had and were conducting immediate and complete internal retraining.

Recall Schedule :

Description of Recall Schedule : Heartland will begin notifying owners/dealers once letters are approved

Planned Dealer Notification Date : JUL 01, 2022 - JUL 01, 2022

Planned Owner Notification Date : JUL 01, 2022 - JUL 01, 2022

* NR - Not Reported