

Thor Motor Coach Recall Repair Instructions

Recall #	22v-300 & 2022-232		
Description/Title:	Defective Quick Connect Brass fitting		
Affected Product Line(s):	Certain model year 2022 Chateau, Compass, Delano, Four Winds, Geneva, Magnitude, Quantum, Rize, Sanctuary, Scope, Sequence, Synergy, Tellaro, Tranquility, & model 2022-2023 Gemini, and Tiburon motorhomes		
Service Campaign #:	RC000263	Released Date:	5/11/2022
Repair Code:	Inspect Only: TMCRC80415Y Repair: TMCRC80415V	Document Date:	5/11/2022
Time Allowed:	Inspect Only: 0.1 Repair: 0.3	Document Revision:	A

Issue:

It has been discovered that on certain model 2022 Chateau, Compass, Delano, Four Winds, Geneva, Magnitude, Quantum, Rize, Sanctuary, Scope, Sequence, Synergy, Tellaro, Tranquility, & model 2022-2023 Gemini, and Tiburon motorhomes, could have a brass LP quick disconnect that may have cracked during installation.

Tools:

- Bottle of soapy water
- Manometer (LP gas tester)
- Adjustable wrench (2)
- Wire brush
- Pipe sealant / Yellow Teflon tape

Parts;

0520729 - RECALL -22V-300 &2022-232 FLEX-TECH QUICK DISCONNECT.

*Dealers wanting to order bulk quick disconnects for all their affected stock can email tmcrecall@flextechhose.com for assistance on bulk ordering.



Thor Motor Coach Recall Repair Instructions

Instructions:

STEP 1: LOCATE THE QUICK DISCONNECT(S);

USUALLY THEY ARE LOCATED ON THE BOTTOM OF THE CHASSIS RAIL;

STEP 2: IDENTIFY THE COLOR OF RUBBER DUST CAP:

- BLACK RUBBER DUST CAP(S) THAT HAS "ENERCO GROUP" ETCHED ON THE SLIDER THIS IS A RECALLED QUICK DISCONNECT AND REMEDY IS REQUIRED
- BLUE RUBBER DUST CAP(S) NOT A RECALLED QUICK DISCONNECT
- YELLOW RUBBER DUST CAP(S) NOT A RECALLED QUICK DISCONNECT

STEP 2A: REMOVE THE QUICK DISCONNECT(S);

- ADJUST ONE WRENCH TO FIT THE HEX FLATS OF THE PIPE NIPPLE INSTALLED INTO THE END OF THE QD WHICH THEN CONNECTS TO A MANIFOLD OR BRACKET CONNECTED TO A LPG HOSE
- ADJUST THE OTHER WRENCH TO FIT THE BODY OF THE QD, KEEP WRENCH CLOSE TO THE PIPE NIPPLE SIDE OF THE QD
- KEEP STEADY PRESSURE ON THE PIPE NIPPLE WRENCH, DO NOT ALLOW IT TO ROTATE;
- UNTHREAD THE QUICK DISCONNECT FROM THE PIPE NIPPLE
- REMOVE ADJUSTABLE WRENCHES AND SET ASIDE FOR USE AGAIN
- USE THE WIRE BRUSH TO CLEAN ANY REMAINING SEALANT OR DEBRIS FROM THE PIPE NIPPLE THREADS
- CLEAN OFF WITH A RAG, ENSURING NOT TO GET ANY DEBRIS INSIDE OF THE PIPE NIPPLE

STEP 2B: INSTALL THE QUICK DISCONNECT(S);

- APPLY EITHER PIPE SEALANT OR YELLOW TEFLON TAPE TO THE PIPE NIPPLE THREADS
- DO NOT APPLY PIPE SEALANT INSIDE OF THE QUICK DISCONNECT
- ADJUST ONE WRENCH TO FIT THE HEX FLATS OF THE PIPE NIPPLE INSTALLED INTO THE END OF THE QD WHICH THEN CONNECTS TO A MANIFOLD OR BRACKET CONNECTED TO A LPG HOSE
- KEEP STEADY PRESSURE ON THE PIPE NIPPLE WRENCH, DO NOT ALLOW IT TO ROTATE
- HAND THREAD THE NEW QUICK DISCONNECT UNTIL TIGHT ONTO THE PIPE NIPPLE
- ADJUST THE OTHER WRENCH TO FIT THE BODY OF THE QD, KEEP WRENCH CLOSE TO THE PIPE NIPPLE SIDE OF THE QD
- TIGHTEN THE QUICK DISCONNECT:
 - IF USING YELLOW TEFLON TAPE: 2 FULL TURNS
 - ORIENT THE LEVER PARALLEL WITH THE GROUND
 - IF USING LP GAS THREAD SEALANT: 1 FULL TURN



Thor Motor Coach Recall Repair Instructions

ORIENT THE LEVER PARALLEL WITH THE GROUND

STEP 3A: IF THE AUXILIARY HOSE HAS A RUBBER BLACK DUST CAP, THE QUICK DISCONNECT NEEDS TO BE

REPLACED;

- ADJUST ONE WRENCH TO FIT THE HEX FLATS OF THE BRASS BARB FITTING INSTALLED INTO THE END OF THE BLACK LP HOSE WHICH THEN CONNECTS TO THE QD
- ADJUST THE OTHER WRENCH TO FIT THE BODY OF THE QD, KEEP WRENCH CLOSE TO THE BRASS BARB FITTING SIDE OF THE QD
- KEEP STEADY PRESSURE ON THE BRASS BARB FITTING WRENCH, DO NOT ALLOW IT TO ROTATE:
- UNTHREAD THE QUICK DISCONNECT FROM THE BRASS BARB FITTING
- REMOVE ADJUSTABLE WRENCHES AND SET ASIDE FOR USE AGAIN
- USE THE WIRE BRUSH TO CLEAN ANY REMAINING SEALANT OR DEBRIS FROM THE BRASS BARB FITTING THREADS
- CLEAN OFF WITH A RAG, ENSURING NOT TO GET ANY DEBRIS INSIDE OF THE BRASS BARB FITTING

STEP 4: **REQUIRED:** (((((perform leak test as specified by your guidelines)))))

• IMPORTANT NOTICE: IF A LEAK IS DETECTED OUTSIDE OF THE QUICK DISCONNECT, THESE ARE REQUIRED TO BE CLAIMED UNDER A SEPARATE LABOR LINE AS THESE ARE NOT A PART OF THE RECALL.