

# Part 573 Safety Recall Report

## 22V-341

**Manufacturer Name :** Shyft Group**Submission Date :** JUN 16, 2022**NHTSA Recall No. :** 22V-341**Manufacturer Recall No. :** 22-01**Manufacturer Information :****Manufacturer Name :** Shyft Group**Address :** 1541 Reynolds Road  
Charlotte MI 48813**Company phone :** 517-543-6400**Population :****Number of potentially involved :** 1,826**Estimated percentage with defect :** 100 %**Vehicle Information :****Vehicle 1 :** 2022-2022 Utilimaster Walk-In Vans**Vehicle Type :** LIGHT VEHICLES**Body Style :** VAN**Power Train :** GAS**Descriptive Information :** Vehicles subject to this recall are final stage vehicles built on incomplete vehicles supplied by Mercedes on which there was a tire size change that was not communicated to Shyft.**Production Dates :** JAN 25, 2022 - APR 11, 2022**VIN Range 1 : Begin :**

NR

**End :** NR☐ Not sequential**Description of Defect :****Description of the Defect :** Tire size and tire pressures on the tire placard as well as the certification label may be inaccurate.**FMVSS 1 :** 110 - Tire selection and rims**FMVSS 2 :** 567 - Certification**Description of the Safety Risk :** Inaccurate information on the required labels may result in over or under inflated tires and overloading of the vehicle which could increase the risk of a crash.**Description of the Cause :** A change in tire size and tire pressures were made by the incomplete vehicle manufacturer without informing Shyft, the final stage manufacturer, of the change proactively.**Identification of Any Warning that can Occur :** Overloading of the vehicle could occur without warning.**Involved Components :**

Component Name 1 : Label

Component Description : Certification Label - Part 567

Component Part Number : 03102792

Component Name 2 : Label

Component Description : Tire Placard - FMVSS 110

Component Part Number : 03104514

### Supplier Identification :

#### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

### Chronology :

On, or near, February 25, 2022, an inquiry was submitted to engineering relating to tire placard information not matching the physical vehicle. (Specifically tire size) On March 16, tire placard information was submitted to Product Compliance however information relating to the vehicle was not. A formal investigation began. On March 30, 2022, potential errors with the certification label were discovered and confirmed to be incorrect. On April 13, a notice was sent to all Utilimaster branded sites to confirm labels contained the correct information that matches the vehicle. Confirmation from all sites but one confirmed labels were accurate. Shyft confirmed the subject population and on May 6, 2022 it determined 2 non-compliances to exist in the affected vehicles.

### Description of Remedy :

Description of Remedy Program : Vehicles subject to this recall are within their respective warranty periods. No reimbursement plan is expected to be needed as incorrect labels would have been replaced without charge.

How Remedy Component Differs from Recalled Component : Labels with correct information would include information that matches the as built tire configuration on the incomplete vehicle.

Identify How/When Recall Condition was Corrected in Production : Pending

**Recall Schedule :**

Description of Recall Schedule : Shyft does not utilize dealers.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : MAY 27, 2022 - MAY 27, 2022

\* NR - Not Reported