

RECALL 22V476 REMEDY INSTRUCTIONS



Make(s): CARGO MATE & CONTINENTAL CARGO
Model(s): SEE BELOW
Model Year(s): 2021 - 2022

Concern:

The safety chains do not meet the Gross Vehicle Weight Rating and could potentially break.

Repair Code: RC-062-01-00-004207
Allotted Time: .50 HRS.
Inspection Code: RC-062-05-00-004206
Allotted Time: .10 HRS.

Photo(s) Required: YES, POST REMEDY
Prior Authorization Required: NO
Part(s) Kit Number: C-5/16x36G4-1C/L/CS
Part(s) Return: NO

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN 2021 & 2022 – CARGO MATE: TXNN714TA3 & TXNN716TA3

CERTAIN 2021 & 2022 – CONTINENTAL CARGO: TXVA714TA3 & TXVA716TA3

STEP 1: LOCATE THE SAFETY CHAIN(S) ON THE ROAD SIDE AND CURB SIDE OF THE DRAW BARS;

STEP 2: TAKE A PHOTO OF HOW THE LOOP IS WELDED TO THE BOTTOM OF THE DRAW BARS;

STEP 3: USING A GRINDER, CUT OFF THE LOOP THAT IS WELDED TO THE DRAW BARS ON EACH SIDE (ROAD SIDE AND CURB SIDE);

NOTE: DO NOT CUT INTO THE DRAW BAR TUBE! THIS WILL PRESENT A STRUCTURAL ISSUE AND WILL NOT BE COVERED BY THE RECALL.

STEP 4: GRIND OFF EXCESS WELD FROM THE DRAW BAR AND SMOOTH OUT;

STEP 5: GRIND OFF PAINT FROM THE DRAW BAR IN THE SAME AREA WHERE THE LOOPS HAD BEEN WELDED;

STEP 6: FROM THE REMEDY KIT, ENSURE THE LOOP THAT WILL BE WELDED TO THE CURB SIDE DRAW BAR IS LOOPED THROUGH THE LAST LINK IN THE OF THE 11,700 LBS. RATED SAFETY CHAIN;

STEP 7: FROM THE REMEDY KIT, ENSURE THE LOOP THAT WILL BE WELDED TO THE ROAD SIDE DRAW BAR IS LOOPED THROUGH THE LAST LINK IN THE OF THE 11,700 LBS. RATED SAFETY CHAIN;

STEP 8: WELD THE LOOPS TO THE DRAW BARS WHERE THE PREVIOUS LOOPS HAD BEEN LOCATED. ENSURE TO REFERENCE THE PHOTO YOU TOOK IN STEP 2 TO ENSURE THE LOOP IS WELDED CORRECTLY;

STEP 9: ALLOW TO COOL, THEN APPLY BLACK SPRAY PAINT TO COVER AND PROTECT THE WELDS AND DRAW BARS WHERE THE PAINT HAD BEEN REMOVED;

STEP 10: CLAIM THE REPAIR CODE.