Part 573 Safety Recall Report

Manufacturer Name :Forest River, Inc.Submission Date :JUL 08, 2022NHTSA Recall No. :22V-489Manufacturer Recall No. :220-1535



22V-489

Manufacturer Information :

Manufacturer Name :Forest River, Inc.MAddress :55470 CR 1EstP.O. Box 3030 Elkhart IN 46515-3030Company phone :1-800-348-7440

Population :

Number of potentially involved :43Estimated percentage with defect :100 %

Vehicle Information :

Vehicle 1 : Vehicle Type : Body Style : Power Train :	OTHER	PTT256BHS Travel Trailers	
	Using manufacturing records, it was determined that the last (most current) production run of this specific model, used the same color wire for the lights in the bathroom as was used for the rear tail lamps. 2022 Coachmen APEX APTT256BHS - 43		
Production Dates : VIN Range 1 :	JUN 01, 2022 - JUN 23, 2022 Begin : NR	End: NR	Not sequential

Description of Defect :

Description of the Defect :	The tail lamps were mistakenly wired to an "ON/OFF" switch.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	If an operator turns the switch "OFF" there will not be any tail lamps, or brake lamps. This condition may lead other motorists to not realize the slowing of the vehicle, which may result in a crash.
Description of the Cause :	Manufacturing used the same color wire for the lights in the bathroom as was used for the rear tail lamps.
Identification of Any Warning that can Occur :	

Involved Components :

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

22V-489

Component Name 1 : Wire Component Description : Wire Component Part Number : N/A

Supplier Identification :

Component Manufacturer

Name : NR Address : NR NR Country : NR

Chronology:

On July 6, 2022, the manufacturing plant received a complaint from a Dealer that when the bathroom ceiling lights are turned off, there will not be any tail lamps or brake lamps.

Upon inspection at the plant on the same day, it was found that the same color wire for the lights in the bathroom was used for the rear tail lamps. The vehicle scope was determined by using manufacturing records that the last (most current) production run of this specific model used the same color wire as explained above.

On July 7, 2022, Forest Rivers Corporate Recall Committee voted to recall

The information contained in this report was submitted pursuant to 49 CFR §573

Description of Remedy :	
Description of Remedy Program :	Forest River will provide all parts and labor free of charge to Consumers and Dealers. An authorized Forest River dealer will need to perform the remedy to correctly wire the tail lamps to work properly away from the bathroom light switch
	What is the Forest River Customer Service Phone Number? (574) 358-0401
	If you have already paid for a repair that is within the scope of this defect under recall, you still need to have this recall inspected and/or performed to ensure the correct parts and procedures were utilized. Additionally, you may be eligible for a refund of previously paid repairs. Refunds will only be provided for within the scope of this defect under recall. Please send the service invoice to the following address:
	APEX Forest River, Inc. Attn: WARRANTY MANAGER PO Box 30 Middlebury, IN 46540
How Remedy Component Differs from Recalled Component :	The tail lamps will now be wired correctly away from the bathroom switch to eliminate the issue. Affected Component – Wire P/N – N/A
	On July 6, 2022, the manufacturing plant decided to use a different color wire for bath ceiling lights than that same color wire that is used for the tail lamps.
Recall Schedule :	
	Forest River has the utmost urgency in our recalls. Forest River will send suspected VIN numbers to our third party vendor that is licensed to pull data on the current owner of the vehicles (as needed) once a formal NHTSA I.D. is provided. Forest River intends on pushing the mailing out as soon as NHTSA provides any correction(s) and an Acknowledgement Letter.
Planned Dealer Notification Date : Planned Owner Notification Date :	

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573