

Part 573 Safety Recall Report

22V-500

Manufacturer Name : Winnebago Industries, Inc.**Submission Date :** JUL 19, 2022**NHTSA Recall No. :** 22V-500**Manufacturer Recall No. :** Recall 167**Manufacturer Information :****Manufacturer Name :** Winnebago Industries, Inc.**Address :** PO BOX 152
605 W. Crystal Lake Rd. Forest City IA
50436**Company phone :** 1-641-585-3535**Population :****Number of potentially involved :** 33**Estimated percentage with defect :** 100 %**Vehicle Information :****Vehicle 1 :** 2021-2022 Winnebago Inspire**Vehicle Type :****Body Style :****Power Train :** NR**Descriptive Information :** Affected VINs were found thru our production records and Engineering drawing records.**Production Dates :** MAY 17, 2021 - NOV 23, 2021**VIN Range 1 : Begin :** NR **End :** NR☐ Not sequential**Description of Defect :****Description of the Defect :** The step well cover support may be insufficient to properly support the step well cover. Due to tolerance it is possible not to have enough overlap of the support surface.**FMVSS 1 :** NR**FMVSS 2 :** NR**Description of the Safety Risk :** if a person steps on the cover and it drops, the person could fall into the stepwell area unexpectedly which could result in an injury.**Description of the Cause :** The stepwell cover dimension was reduce to aid manufacturing in early 2021. Tolerance and overlap analysis was not sufficiently done.**Identification of Any Warning** NR
that can Occur :**Involved Components :**

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

6-16-22 Received e-mail from customer letting us know his step cover failed.

June 2022 Inspire group researched the cause

7-1-22 Safety Committee reviewed the research done by the group responsible for the Inspire model.

Description of Remedy :

Description of Remedy Program : The support surface is increased from .75 inches wide to 1.50 inches wide to provide sufficient overlap for the step to rest on.

How Remedy Component Differs from Recalled Component : The support surface is increased from .75 inches wide to 1.50 inches wide to provide sufficient overlap for the step to rest on.

Identify How/When Recall Condition was Corrected in Production : The same support is now used in production. The recalled field units will match our current production units.

Recall Schedule :

Description of Recall Schedule : Letters to be mailed out within 60 days see table to the right

Planned Dealer Notification Date : AUG 31, 2022 - AUG 31, 2022

Planned Owner Notification Date : AUG 31, 2022 - AUG 31, 2022

* NR - Not Reported