

Part 573 Safety Recall Report

22V-500

Manufacturer Name : Winnebago Industries, Inc.**Submission Date :** AUG 18, 2022**NHTSA Recall No. :** 22V-500**Manufacturer Recall No. :** Recall 167**Manufacturer Information :****Population :**

Manufacturer Name : Winnebago Industries, Inc.

Number of potentially involved : 33

Address : PO BOX 152
605 W. Crystal Lake Rd. Forest City IA
50436

Estimated percentage with defect : 100 %

Company phone : 1-641-585-3535

Vehicle Information :

Vehicle 1 : 2021-2022 Winnebago Inspire

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Affected VINs were found thru our production records and Engineering drawing records.

Production Dates : MAY 17, 2021 - NOV 23, 2021

VIN Range 1 : Begin : NR

End : NR

☐ Not sequential**Description of Defect :**

Description of the Defect : The step well cover support may be insufficient to properly support the step well cover. Due to tolerance it is possible not to have enough overlap of the support surface.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : if a person steps on the cover and it drops, the person could fall into the stepwell area unexpectedly which could result in an injury.

Description of the Cause : The stepwell cover dimension was reduce to aid manufacturing in early 2021. Tolerance and overlap analysis was not sufficiently done.

Identification of Any Warning NR
that can Occur :**Involved Components :**

Component Name 1 : Step support

Component Description : NR

Component Part Number : 339720-01-000 rev B

Supplier Identification :

Component Manufacturer

Name : Winnebago Ind Inc.

Address : PO box 152

Forest City Iowa 50436

Country : United States

Chronology :

6-16-22 Received e-mail from customer letting us know his step cover failed resulting in 1 injury.

June 2022 Inspire group researched the cause

7-1-22 Safety Committee reviewed the research done by the group responsible for the Inspire model.

Description of Remedy :

Description of Remedy Program : The .75 wide support surface was replaced with 1.50 inch wide support surface to provide sufficient overlap for the step to rest on. reimbursement will be handled by our general reimbursement plan which is on file.

How Remedy Component Differs from Recalled Component : The support surface is increased from .75 inches wide to 1.50 inches wide to provide sufficient overlap for the step to rest on.

Identify How/When Recall Condition was Corrected in Production : The same support is now used in production. The recalled field units will match our current production units.

Recall Schedule :

Description of Recall Schedule : Letters to be mailed out within 60 days see table to the right

Planned Dealer Notification Date : AUG 31, 2022 - AUG 31, 2022

Planned Owner Notification Date : AUG 31, 2022 - AUG 31, 2022

* NR - Not Reported