OMB Control No.: 2127-0004

Part 573 Safety Recall Report

22V-529

Manufacturer Name: Ember Recreational Vehicles, INC

Submission Date: JUL 22, 2022 NHTSA Recall No.: 22V-529 Manufacturer Recall No.: NR



Manufacturer Information:

Manufacturer Name: Ember Recreational Vehicles, INC

Address: 710 Commerce Drive

Bristol IN 46507

Company phone: 5998606

Population:

Number of potentially involved: 130 Estimated percentage with defect: 34 %

Vehicle Information:

Vehicle 1: 2022-2022 Ember Overland Series - 191MDB, 190MDB, 170MBH, 170MRB

Vehicle Type: TRAILERS

Body Style : Power Train : NR

Descriptive Information: Ember determined the recall scope from the review of purchase orders for LP

components and production records. Non-recalled product use LP manifolds from a

different vendor.

Production Dates: OCT 18, 2021 - MAR 24, 2022

Description of Defect:

Description of the Defect: LP Gas Quick disconnects manufactured by Enerco Flex-Tech may crack under

vendor prescribed torque values. In some cases the cracking may result in a propane leak. Enerco Flex Tech quick disconnects are part of a larger assembly provided by Flex Tech or may be installed on the production floor. Ember RV is

not aware of any thermal events related to this defect.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: A cracked LP quick disconnect fitting can lead to a propane leak, which

increases the risk of a fire. The fittings in questions are located outside of the

living section of the RV.

Description of the Cause: When the fitting is tightened, the brass female housing may crack. The vendor

has determined the root cause to be porosity in the cast component.

Identification of Any Warning A cracked disconnect is detectable by the smell of propane gas.

that can Occur:

Involved Components:

Component Name 1 : LP Quick Disconnect Component Description : LP Quick Disconnect

Component Part Number: 76290W

Supplier Identification:

Component Manufacturer

Name: Flex-Tech Hose & Tubing, LLC

Address: 1100 Civic Center Loop

San Marcos Texas 78666

Country: United States

Chronology:

In late May of 2022 Ember became aware of a possible recall of FlexTech quick connect components. The vendor was contacted several times but no information on the scope or nature of the recall was provided. Ember attained this information on or around June 8th from the NHTSA website. A review of purchase orders and production schedules determine that approximately 44 commercially available units were built with the potentially defective LP quick connect. A review of warrantee claims found one complaint for a cracked LP fitting from 7/6/22 but Ember was unable to retrieve the defective component to determine if it was a FlexTech brand quick connect. On 7/21/22 the Ember Leadership team determined that a recall was required.

Description of Remedy:

Description of Remedy Program: All suspect components will be replaced with conforming components

from a different supplier at no cost to the customer.

How Remedy Component Differs The replacement component will not crack when torqued to the vendor

from Recalled Component: specified value.

Identify How/When Recall Condition Ember switched to another vendor in October of 2021 and the on hand was Corrected in Production: stock of FlexTech Quick Connects were used whenever there was a supply

shortfall. The last FlexTech QuickConnect was installed in March of 2022.

Recall Schedule:

Description of Recall Schedule: Owners of affected vehicles will be notified by First Class mail or

electronically. Ember will post recall information electronically for consumer access. Dealers will be notified of the recall action by First Class mail or electronically and will be supplied with repair instructions and vehicle identification information.

Planned Dealer Notification Date : SEP 05, 2022 - SEP 09, 2022 Planned Owner Notification Date : SEP 05, 2022 - SEP 09, 2022

* NR - Not Reported