Part 573 Safety Recall Report

Manufacturer Name :Shyft GroupSubmission Date :AUG 09, 2022NHTSA Recall No. :22V-531Manufacturer Recall No. :22-04

Manufacturer Information :

Manufacturer Name : Shyft Group Address : 1541 Reynolds Road Charlotte MI 48813 Company phone : 517-543-6400

Vehicle Information :

Vehicle 1:	2022-202	3 Spartan RV Ch	assis K1, K2, K3 and K4	
Vehicle Type :	BUSES, MEDIUM & HEAVY VEHICLES			
Body Style :	UNKNOWN			
Power Train :	DIESEL			
Descriptive Information :	The affected chassis are equipped with a Meritor IFS and steering gear supplied by RH Sheppard. These chassis would be the only ones built with that configuration.			
Production Dates :	OCT 07, 2	021 - JUN 17, 202	22	
VIN Range 1:	Begin :	NR	End: NR	□ Not sequential

Population :

Description of Defect :

Description of the Defect :	In 22E-047, RH Sheppard indicated steering gear was assembled with fewer than the required number of recirculating balls which can lead to a fracture in the steering gear worm-shaft and loss of vehicle steering.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	In 22E-047, RH Sheppard asserts a steering gear with fewer than the required number of recirculating balls may bind when loads are applied. In some cases the balls may align on the same side of the gear's worm-shaft and concentrated loads may cause the gear's internal parts to fracture resulting in loss of vehicle steering. Loss of steering increases the likelihood of a crash.
Description of the Cause :	An anomaly in the steering gear recirculating ball insertion operation occurred during assembly. Subsequent rework processes and inspections did not detect the missing recirculating balls.
5 0	Preceding the internal fracture, the steering may be perceived as strained by the driver. No audible or visual warning is available.



Number of potentially involved : 100 Estimated percentage with defect : 6 %

22V-531

Involved Components :

Component Name 1:	Steering Gear
Component Description :	Steering Gear
Component Part Number :	M100PWJ3

Supplier Identification :

Component Manufacturer

Name : R.H.Sheppard Co., Inc Address : 901 Cleveland St Elyria Ohio 44035 Country : United States

Chronology:

On, or near, June 8, 2022, Product Compliance became aware of R.H. Sheppard's recall 22E-047. Due to an unrelated matter, the recall was sent to Shyft's engineering team who then contacted Meritor, the assembler of the Independent Front Suspension. On June 16, 2022 Sheppard confirmed serial numbers of gears that Shyft or Meritor may have received. On, June 17, 2022, a stop ship was put in place at Shyft to inspect all suspect steering gears. Shyft continued to work with Meritor to identify the small number of affected gears. Due to the inability to narrow the population, Shyft determined a defect relating to motor vehicle safety could exist in the affected vehicles on July 22, 2022. During a review of the file on 8/2/2022. for this recall in preparation for campaign launch, the beginning and end dates of manufacturing for the population and number of vehicles affected were determined to be incorrect.

Description of Remedy :

Description of Remedy Program :	Service providers will inspect the steering gear to determine its serial number. If a suspect steering gear is identified, the motorhome will need to be returned to the factory for steering gear replacement. The affected vehicles are within their warranty period.
	The remedy steering gears were assembled with the correct number of recirculating balls where the recalled steering gears may not have been
0	The affected chassis and IFS's in Shyft's direct control were placed on stop ship and confirmed to be not be equipped with the affected steering gears on June 17, 2022.

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

Recall Schedule :

Description of Recall Schedule :Shyft does not have dealers for this product line.Planned Dealer Notification Date :NR - NRPlanned Owner Notification Date :AUG 12, 2022 - AUG 12, 2022

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573