


RECALL 22V586, 2022-432 - REMEDY INSTRUCTIONS

	Make(s): TRACER Model(s): TRT26KSS Model Year(s): 2021	Repair Code: RC-058-01-00-004225 Allotted Time: 3.50 HRS. Inspection Code: N/A Allotted Time: N/A
	Concern: The water heater exhaust may melt and cause distortion on the passenger side rear tail lamp. Replace Tail lamps with new tail lamps.	Photo(s) Required: YES Prior Authorization Required: YES Part(s) Kit Number: F100282000 Part(s) Return: NO


Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

STEP 1:

- REMOVE THE LENS FROM BOTH TAIL LAMPS TO GAIN ACCESS TO THE FASTENERS;
 - REMOVE FASTENERS AND SET ASIDE FOR REUSE;
 - MAKE A NOTE OR TAKE A PHOTO OF WHICH WIRES ARE CONNECTED TO THE TAIL LAMPS;
 - CUT OR DISCONNECT THE WIRES ON THE TAIL LAMPS FROM THE WIRES COMING OUT OF THE REAR WALL OF THE UNIT;
- *NOTE – DO NOT CUT AND REUSE THE TAIL LAMP WIRES***
- DISCARD THE TAIL LAMPS.

STEP 2:


- REMOVE ANY SEALANT THAT IS ON THE REAR WALL WITH A RAZOR;

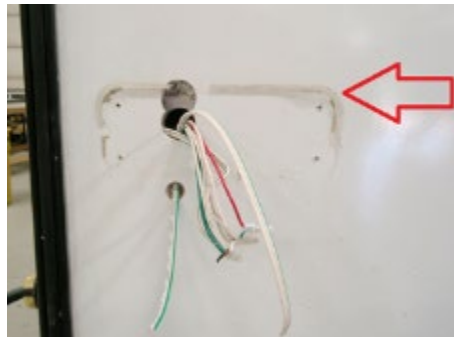

- TAPE PAPER OVER PRE-BEND MOLDING, WATER HEATER AND BUMPER TO PROTECT FROM ANY OVERSPRAY;



- USING A CIRCULAR GRINDING TOOL, GRIND DOWN THE SCREWS HOLES THAT WILL NOT BE COVERED BY THE TAIL LAMP;
- *PLEASE NOTE: THE NEW TAIL LAMP WILL BE INSTALLED VERTICALLY***

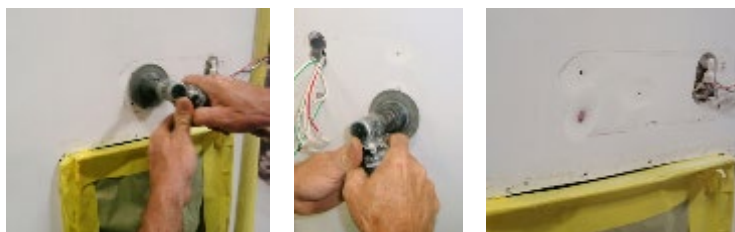

RECALL 22V586, 2022-432 - REMEDY INSTRUCTIONS



Make(s): TRACER
Model(s): TRT26KSS
Model Year(s): 2021

Concern:


The water heater exhaust may melt and cause distortion on the passenger side rear tail lamp. Replace Tail lamps with new tail lamps.

Repair Code: RC-058-01-00-004225
Allotted Time: 3.50 HRS.
Inspection Code: N/A
Allotted Time: N/A
Photo(s) Required: YES
Prior Authorization Required: YES
Part(s) Kit Number: F100282000
Part(s) Return: NO


D. FILL IN THE HOLES WITH BONDO AND THE SURROUNDING AREA AND ALLOW TO DRY;





E. SAND THE BONDO AREA UNTIL SMOOTH AND REAPPLY BONDO WHERE NEEDED, SAND AGAIN;

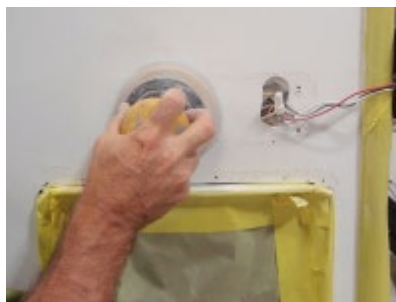

F. CLEAN OFF THE AREA WITH AN AIR NOZZLE AND PRIME THE AREA;

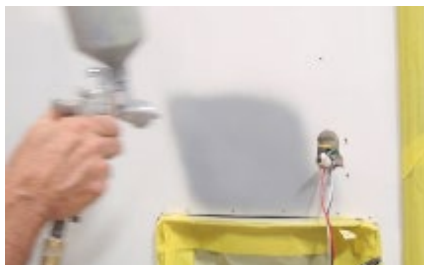

G. USING A SCOWLING PAD, SCUFF THE AREA SO THE PAINT WILL STICK TO THE WALL;

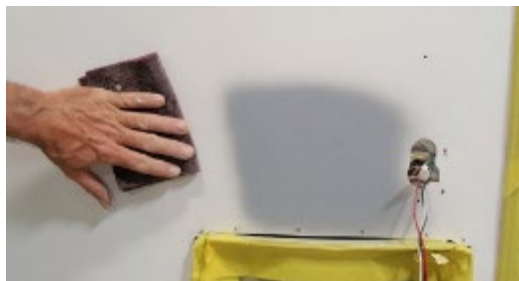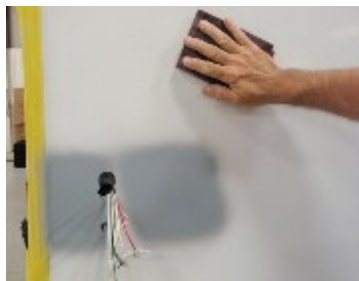

RECALL 22V586, 2022-432 - REMEDY INSTRUCTIONS




Make(s): TRACER
Model(s): TRT26KSS
Model Year(s): 2021

Concern:
The water heater exhaust may melt and cause distortion on the passenger side rear tail lamp. Replace Tail lamps with new tail lamps.

Repair Code: RC-058-01-00-004225
Allotted Time: 3.50 HRS.
Inspection Code: N/A
Allotted Time: N/A
Photo(s) Required: YES
Prior Authorization Required: YES
Part(s) Kit Number: F100282000
Part(s) Return: NO

H. CLEAN OFF AREA WITH AN AIR NOZZLE, PAINT THE AREA AND ALLOW TO DRY;

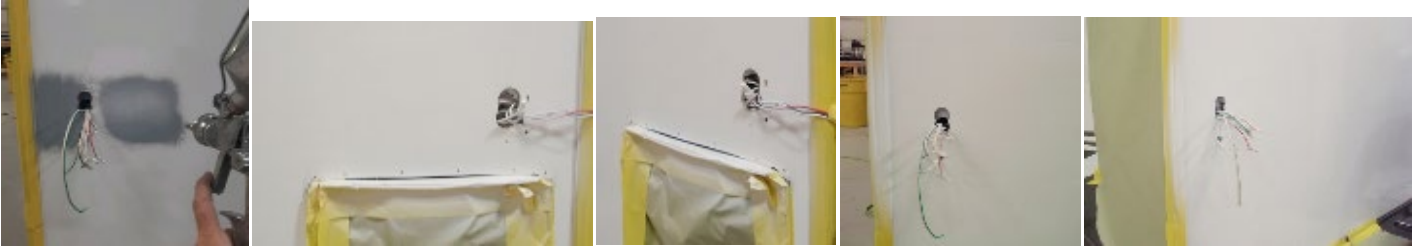

I. APPLY CLEAR COAT TO THE AREA;



STEP 3:


A. DRILL WIRE OPENING ABOUT AN 1 – 1 ¼" ABOVE EXISTING HOLE, JUST THROUGH THE GLASS AND NOT ALL THE WAY THROUGH THE WALL;



B. YOU MAY HAVE TO USE A TOOL TO REMOVE SOME OF THE ALUMINUM TUBING TO ALLOW SPACE FOR THE WIRING ON THE BACK SIDE OF THE NEW TAIL LAMP;



RECALL 22V586, 2022-432 - REMEDY INSTRUCTIONS

	Make(s): TRACER Model(s): TRT26KSS Model Year(s): 2021	Repair Code: RC-058-01-00-004225 Allotted Time: 3.50 HRS. Inspection Code: N/A Allotted Time: N/A
	Concern: The water heater exhaust may melt and cause distortion on the passenger side rear tail lamp. Replace Tail lamps with new tail lamps.	Photo(s) Required: YES Prior Authorization Required: YES Part(s) Kit Number: F100282000 Part(s) Return: NO

- C. CONNECT NEW TAIL LAMP ABOVE WATER HEATER; ***REFER TO THE NOTES OR PHOTO FROM STEP 1-C TO CONNECT THE WIRING***



- D. INSTALL NEW TAIL LAMP VERTICALLY SO IT COVERS THE TWO SCREW HOLES CLOSEST TO THE PRE-BEND MOLDING;



- E. INSTALL COSMETIC SNAP RING FOR NEW TAIL LAMP AND CAP SEAL WITH SILICONE.



RECALL 22V586, 2022-432 - REMEDY INSTRUCTIONS



Make(s): TRACER
Model(s): TRT26KSS
Model Year(s): 2021

Concern:
The water heater exhaust may melt and cause distortion on the passenger side rear tail lamp. Replace Tail lamps with new tail lamps.

Repair Code: RC-058-01-00-004225
Allotted Time: 3.50 HRS.
Inspection Code: N/A
Allotted Time: N/A
Photo(s) Required: YES
Prior Authorization Required: YES
Part(s) Kit Number: F100282000
Part(s) Return: NO

F. REPEAT STEPS 3, A-E ON THE OFF DOOR SIDE REAR TAIL LAMP;



G. DRILL $\frac{3}{4}$ " HOLE BELOW THE TAIL LAMP HOLE A MINIMUM OF 2";



H. INSTALL JUMPER WIRE TO LICENSE PLATE BRACKET HOLE FROM OFF DOOR SIDE TAIL LAMP HOLE;



- I. CONNECT WIRING FROM THE NEW TAIL LAMP FROM THE WIRES COMING OUT OF THE REAR WALL OF THE UNIT;
- J. BEFORE INSTALLING NEW TAIL LAMP MAKE SURE YOUR MEASUREMENT MATCHES THAT ON THE DOOR SIDE REAR TAIL LAMP;
- K. INSTALL NEW TAIL LAMP VERTICALLY SO IT COVERS THE TWO SCREW HOLES CLOSEST TO THE PRE-BEND MOLDING;
- L. INSTALL COSMETIC SNAP RING FOR NEW TAIL LAMP AND CAP SEAL WITH SILICONE;
- M. LOCATE THE NEW LICENSE PLATE BRACKET AND APPLY BUTYL TAPE TO THE BACK SIDE;
- N. CONNECT THE WIRES TO THE LICENSE PLATE BRACKET;
- O. INSTALL LICENSE PLATE BRACKET BELOW THE TAIL LAMP USING THE FASTENERS THAT WERE SET ASIDE AND CAP SEAL;
- P. CLAIM REPAIR CODE.